



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123

Case Vehicle (A): 1998 Lincoln
 Type: Continental, 4-door sedan
 Driver: 66-year-old female
 CDC: 12-FCEN-3

SITUATION

(Slides 1, 2) On a clear, dry day, case vehicle (A) was traveling south in a residential area at an unknown speed, in the southbound lane of a three-lane asphalt road. (Slides 3, 4) The driver of case vehicle (A) fell asleep while driving and the vehicle crossed the center turn lane and the northbound lane. (Slide 5) Tire marks indicate that case vehicle (A) left the east edge of the roadway, went up a curb, traveled 7 meters south, and struck a tree with its front bumper. (Slide 6) The tree was located 1.2 meters east of the road edge and was 36 cm in diameter. (Slide 7) Case vehicle (A) came to rest facing in a southeast direction against the tree.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slides 8, 9) The direct damage to the front of case vehicle (A) began 57 cm in from the left-front bumper corner and extended 36 cm across the front. The maximum crush to the center portion of the bumper was 71 cm.

Using the WinSMASH accident-reconstruction program and c-values measured for (slides 10, 11, 12, 13 and 14) case vehicle (A), the following impact severity was calculated for the frontal impact with the tree.

Vehicle	Variable	Calculated Velocity Change - kph (mph)		
		Total	Longitudinal	Latitudinal
Case Vehicle (A)	EBS	45 (28)	-45 (-28)	0 (0)

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

(Slide 15) The front bumper was crushed, the grille was damaged, and both headlight assemblies were partially detached but were unbroken. (Slide 16) The hood was crushed and the hood latch

was damaged, although it is unknown if the hood latch had released or was jammed and pried open. There was no damage to the hood hinges. (Slides 17, 18) The rear edge of the hood was elevated, and it contacted and cracked the lower portion of the windshield. (Slides 19, 20) Both sides of the roof were buckled due to the severe frontal deformation.

(Slide 21) On the left side, the front fender was damaged and the left upper A-pillar was slightly deformed. (Slide 22) Both left-side doors were operable and no window glass was broken.

(Slide 23) The left wheelbase was reduced 4 cm. (Slide 24) There was no other damage to the left side.

(Slide 25) On the right side, the front fender was damaged and the upper and lower A-pillars were deformed. In addition, the right-front door was jammed closed and the wheelbase was reduced 7 cm. (Slide 26) There was no other damage to the right side.

Interior

(Slides 27, 28) This vehicle is equipped with steering-wheel and passenger frontal-impact airbags, which deployed during the frontal impact. (Slide 29) Pink lipstick on the steering-wheel airbag skin indicates that the driver's face contacted the airbag. (Slides 30, 31) There was no damage to the steering-wheel rim, but the column was rotated slightly up and to the left. (Slide 32) There was a scuff mark on the left side of the upper panel, but no visible damage. (Slide 33) The trim piece on the mid portion of the instrument panel was displaced. (Slides 34, 35) The knee bolster was contacted and damaged. (Slide 36) There was a scuff mark on the center instrument panel, but there was no actual damage. Also the center console was deformed and the glove compartment was damaged. (Slide 37) The gas pedal was bent, probably due to driver foot contact, and the (slide 38) rear-view mirror came off of the windshield, but the glass was not broken. (Slides 39, 40) In addition, both the left and right portions of the headlining were damaged from remote roof buckling. (Slides 41, 42) The driver seat backrest was damaged, the seat was rotated forward, and the seat adjuster was jammed. There was no other interior damage and no intrusions were noted.

OCCUPANT KINEMATICS AND INJURIES

(Slide 43) The 66-year-old, 5-ft, 4 in, 175-lb female driver was wearing the available three-point belt, and the airbag deployed. (Slides 44, 45 and 46) Clothing transfers on the lap-belt webbing

indicate belt use at the time of the crash. (Slide 47) The shoulder-belt anchor point was adjusted to the highest position on the B-pillar and the driver reportedly had the seat adjusted to a forward-track position. She did not know how the tilt steering wheel was positioned prior to the crash.

During the frontal impact with the tree, the driver continued forward relative to the vehicle interior into the belt restraints and the airbag. (Slide 48) She sustained abrasions to her lower lip and chin from the deploying airbag, as indicated by lipstick on the airbag skin. She sustained contusions to her right breast, probably due to loading by the shoulder portion of the three-point belt, or possibly from contact with the airbag. In addition, she sustained contusions across her abdomen, probably due to loading by the lap portion of the belt, or possibly from the airbag. (Slide 49) She sustained a fracture to her right wrist, probably from contact with the vertical console, as indicated by a scuff mark, or possibly from contact with the rear-view mirror. (Slide 50) A scuff mark to the left portion of the upper panel indicates that the driver may have contacted it, but no injuries were noted. (Slide 51) Also, she sustained contusions to her right knee, from contact with the knee bolster, as indicated by a scuff mark to the right portion of the panel. (Slide 52) She sustained contusions to her left knee, from contact with the knee bolster, as indicated by a scuff mark to the left portion of the panel. (Slides 53, 54) She sustained contusions to the tops of her right and left feet, probably from contact with the foot controls, as indicated by deformation to the gas pedal.

The following table and attached drawing (slide 55) summarize the injuries for the restrained driver.

Occupant: Driver
Restraints: 3-point belt worn; airbag deployed

Age: 66 years
Stature: 163 cm (5 ft, 4 in)

Sex: Female
Mass: 79 kg (175 lb)

Injury Description	A.I.S.	Injury Source		
		Definite	Probable	Possible
Abrasion, lower lip	1	Airbag		
Abrasion, chin	1	Airbag		
Contusions, right breast	1		Shoulder belt	Airbag
Contusions, across abdomen	1		Lap belt	Airbag
Fracture, right wrist	2		Center vertical console	Rear-view mirror
Contusions, right knee	1	Knee bolster		
Contusions, left knee	1	Knee bolster		
Contusions, top of left foot	1		Gas pedal/ brake pedal	
Contusions, top of right foot	1		Gas pedal/brake pedal	
<u>Maximum A.I.S. Level</u>	<u>2</u>			
<u>Injury Severity Score</u>	<u>5</u>			

Duplicate columns 1-8
from the previous card.

Module G 1 Format 0 2
9 10 11 12

GENERAL INFORMATION GI-1

TIME

DATE OF COLLISION

 / /

HOUR OF COLLISION (24 HOUR CLOCK)

LOCATION

STATE:

STATE FIPS CODE

AREA

- (1) URBAN
(2) RURAL
(9) UNKNOWN

ENVIRONMENTAL CONDITIONS

LIMITED-ACCESS HIGHWAY

- (0) NO
(1) YES
(9) UNKNOWN

ROAD, TOTAL TRAFFIC LANES (FOR CASE VEHICLE)

- (1) 1-LANE
(2) 2-LANES
(3) 3-LANES
(4) 4 OR MORE LANES
(5) DIVIDED, 4 OR MORE LANES
(6) PARKING LOT/DRIVEWAY
(7) OTHER:
(9) UNKNOWN

INTERSECTING RD, TOTAL LANES CHOOSE FROM ABOVE LIST, OR

- (8) NOT APPLICABLE

TYPE OF ROAD SURFACE

- (1) ASPHALT
(2) CONCRETE
(3) GRAVEL
(4) MORE THAN ONE (CIRCLE EACH)
(7) OTHER:
(9) UNKNOWN

ROAD DEFECTS

- (0) NO
(1) YES
(9) UNKNOWN

ENVIRONMENTAL CONDITIONS

CONSTRUCTION ZONE

- (0) NO
(1) YES
(9) UNKNOWN

ROAD ALIGNMENT VERTICAL PLANE

- (1) LEVEL
(2) CREST OF HILL
(3) SLOPE (2%)
(4) BOTTOM OF HILL
(9) UNKNOWN

ROAD ALIGNMENT HORIZONTAL PLANE

- (1) STRAIGHT
(2) CURVE
(3) T - SHAPED
(4) Y - SHAPED
(7) OTHER:
(9) UNKNOWN

SURFACE COVERING

- (10) DRY

(21) WATER - DAMP
(22) WATER - WET
(23) WATER - PUDDLED
(29) WATER - AMOUNT UNKNOWN

(31) SNOW - LOOSE
(32) SNOW - PACKED
(39) SNOW - CONDITION UNKNOWN

(41) ICE
(51) SLUSH
(61) SPILLED GRAVEL
(71) OTHER:
(99) UNKNOWN

VISIBILITY LIMITATION (FOR CASE VEHICLE)

- (0) NONE
(1) CLOUDY/DARK
(2) FOG
(3) SMOKE
(4) WINDSHIELD CONDITION
(5) GLARE
(6) RAIN
(7) OTHER:
(8) ICE/SNOW
(9) UNKNOWN

VISIBILITY OBSTRUCTION (FOR CASE VEHICLE)

- (0) NONE
(1) BUILDING
(2) SIGN
(3) VEGETATION (E.G. BUSHES, SHRUBS)
(4) TREE
(5) HILL OR CURVE IN ROAD
(6) VEHICLE IN TRANSPORT
(7) OTHER:
(8) PARKED VEHICLE
(9) UNKNOWN

GENERAL INFORMATION GI-3

CRASH DETAILS

CASE VEHICLE AND OBJECT

- (0) NO
- (1) YES
- (9) UNKNOWN

1
47

CASE VEHICLE ROLLOVER

- (0) NO ROLLOVER
- (1) YES, FIRST EVENT
- (2) YES, SUBSEQUENT EVENT
- (3) YES, SEQUENCE UNKNOWN
- (9) UNKNOWN

0
48

CASE VEHICLE RAN OFF ROADWAY (BEFORE FIRST IMPACT)

- (0) NO
- (1) YES
- (9) UNKNOWN

1
49

MOVING CASE VEHICLE AND CONTACTED MOVING VEHICLE

- (0) NO
- (1) YES
- (9) UNKNOWN

0
50

CASE VEHICLE AND CONTACTED STOPPED VEHICLE

- (0) NO
- (1) YES
- (9) UNKNOWN

0
51

STOPPED CASE VEHICLE AND CONTACTED VEHICLE

- (0) NO
- (1) YES
- (9) UNKNOWN

0
52

TOTAL NUMBER OF VEHICLES CONTACTED BY CASE VEHICLE IN CRASH

- (8) 8 OR MORE
- (9) UNKNOWN

0
53

ANY FIRE IN THIS CRASH (NOT JUST CASE VEHICLE)

- (0) NO
- (1) YES
- (9) UNKNOWN

0
54

HIGHEST POLICE INJURY SEVERITY CODE IN CRASH (NOT JUST CASE VEHICLE)

- (0) O - NO INJURY
- (1) C - POSSIBLE INJURY
- (2) B - NON-INCAPACITATING INJURY
- (3) A - INCAPACITATING INJURY
- (4) K - FATAL
- (5) INJURED, SEVERITY UNKNOWN
- (6) DIED PRIOR TO ACCIDENT
- (7) NON-FATAL INJURY
SEVERITY UNKNOWN
- (9) UNKNOWN

3
55

DRIVER IMPAIRMENT

DRIVER ALCOHOL INVOLVEMENT (CASE VEHICLE)

- (0) NONE
- (1) YES
- (9) UNKNOWN/NOT REPORTED/
NO DRIVER

0
56

DRIVER ALCOHOL BAC (CASE VEHICLE)

- (80) NO TEST
- (90) CHEMICAL TESTS, NO RESULTS
- (95) AUTOPSY, NO RESULTS
- (99) UNKNOWN

80
57 58

WAS THERE MENTION OF DRIVER IMPAIRMENT FOR CASE VEHICLE?

- (0) NO
- (1) YES
- (9) UNKNOWN

0
59

LIST IMPAIRMENTS MENTIONED:

POST - CRASH DETAIL

MANNER CASE VEHICLE LEFT SCENE

- (1) DRIVEN
- (2) TOWED DUE TO DAMAGE
- (3) TOWED, NOT DUE TO DAMAGE
- (4) TOWED, REASON UNKNOWN
- (9) UNKNOWN

2
60


ACCIDENT SCHEMATIC

ACCIDENT DESCRIPTION: CASE VEHICLE (A) WAS TRAVELING
SOUTH AT AN UNKNOWN SPEED IN THE SOUTHBOUND
LANE IN A RESIDENTIAL AREA. THE DRIVER FELL
ASLEEP AND THE VEHICLE CROSSED THE CENTER TURN LANE AND NORTHBOUND
LANE. TIRE MARKS INDICATE THE VEHICLE LEFT THE EAST EDGE OF THE ROAD
AND TRAVELED 7 METERS BEFORE STRIKING A 36-CM DIAMETER TREE WITH
ITS FRONT END.

CASE VEHICLE (A): 1998 LINCOLN CONTINENTAL
 OTHER VEHICLE (B): -
 THIRD VEHICLE (C): -



NORTH

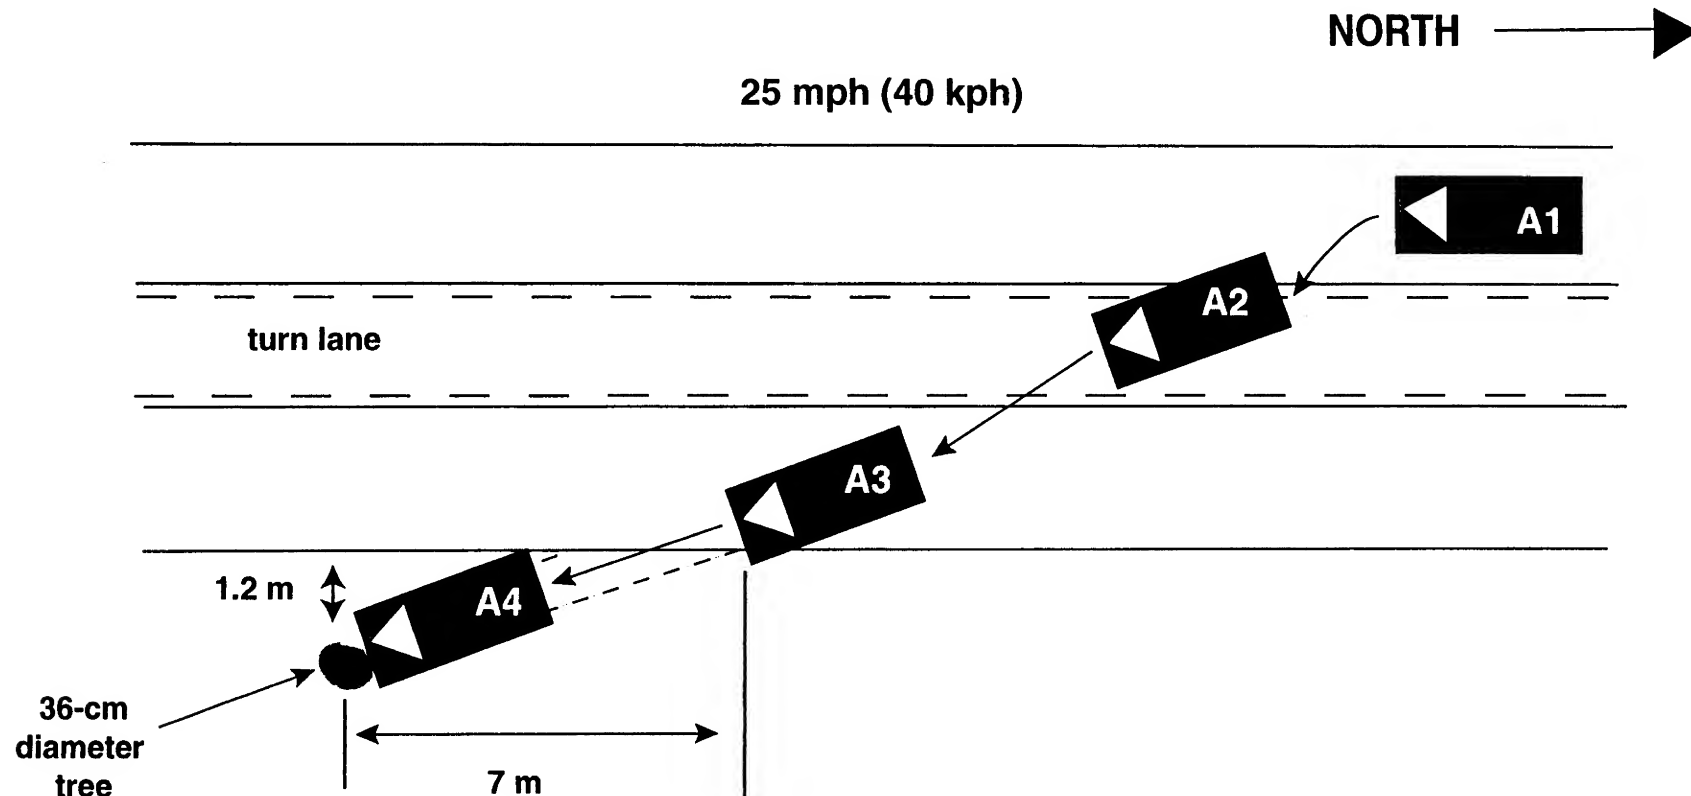

Duplicate columns 1-8
from the previous card.

Module 0 V Format 0 4
9 10 11 12

OTHER VEHICLE OV-1

MAKE: _____

CARGO: _____

MODEL: _____

VIN

13

29

MANUFAC/BODY CODE

30

34

MAKE/MODEL CODE

38

MODEL YEAR

39

42

VEHICLE MASS (kg)

43

48

IF SEPARATE REPORT WAS MADE,
GIVE VEHICLE NUMBER

NUMBER OF OCCUPANTS
(ENTER 9'S IF UNKNOWN)

51

TRAVELING SPEED (km/h)

54

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

HIGHEST POLICE INJURY SEVERITY
CODE FOR THIS VEHICLE

- (0) O - NO INJURY
(1) C - POSSIBLE INJURY
(2) B - NON-INCAPACITATING INJURY
(3) A - INCAPACITATING INJURY
(4) K - FATAL
(5) INJURED, SEVERITY UNKNOWN
(6) DIED PRIOR TO ACCIDENT
(7) NON-FATAL INJURY
SEVERITY UNKNOWN
(8) UNOCCUPIED VEHICLE
(NOT APPLICABLE)
(9) UNKNOWN

55

VEHICLE TYPE

PASSENGER VEHICLE

- (02) LARGE
(03) LIMOUSINE
(17) PICKUP CAR
(20) UNKNOWN PASSENGER VEHICLE BODY
(24) SUB-MINI
(25) MINI
(26) SUB-COMPACT
(27) COMPACT
(28) INTERMEDIATE
(29) FULL

56

57

MULTIPURPOSE PASSENGER VEHICLE

- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
(15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(17) PICKUP CAR WITH CANOPY/SHELL COVER
(21) MOTOR HOME
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(23) PICKUP CAR WITH SLIDE-IN CAMPER
(31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) VAN
(12) PICKUP TRUCK
(13) UNKNOWN LIGHT TRUCK
(15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(16) PICKUP TRUCK WITH CANOPY/SHELL COVER
(22) PICKUP TRUCK WITH SLIDE-IN CAMPER
(30) UNKNOWN TRUCK TYPE
(31) CHASSIS-MOUNTED CAMPER
(33) DELIVERY VAN (WALK-IN)
(34) STRAIGHT TRUCK
(35) TRUCK-TRACTOR (BOBTAIL)
(36) CHASSIS-CAB
(37) UNKNOWN HEAVY TRUCK
(38) TRACTOR & SEMI-TRAILER (SEMI)
(39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
(41) SCHOOL BUS
(42) INTERCITY BUS (BETWEEN CITIES)
(43) TRANSIT BUS (INTRACITY)
(44) STREETCAR (ON TRACKS)

- (68) TRAIN (CARS)
(69) LOCOMOTIVE (ENGINE, SWITCHER)

- (99) UNKNOWN

WHEELBASE (cm)

- (999) UNKNOWN

58 59 60

NOT APPLICABLE

Duplicate columns 1-8
from the previous card.

Module 0 V Format 0 2
9 10 11 12

OTHER VEHICLE OV-2

ORIGINAL SPECIFICATIONS

Wheelbase	_____ cm	Front Overhang	_____ cm
		22 _____ 24	
Curb Weight	_____ kg	Rear Overhang	_____ cm
		25 _____ 27	
Average Track Width	_____ cm	Undeformed End Width (UEW)	_____ cm
13 _____ 15		28 _____ 30	
Overall Length	_____ cm	Engine Displacement	_____ L
16 _____ 18		31 _____ 32	
Overall Width (OAW)	_____ cm	Engine: # of Cylinders	_____
19 _____ 21		33 _____ 34	

VEHICLE DAMAGE

NOT APPLICABLE

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) _____ cm

35 _____ 37

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$ _____ %

38 _____ 39

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$ _____ %

40 _____ 41

Duplicate columns 1-8
from the previous card.

Module V D Format 0 4
9 10 11 12

VEHICLE DESCRIPTION VD-1

MAKE: LINCOLN
MODEL: CONTINENTAL 4-DOOR SEDAN

CARGO: NONE

VIN 1 L N F M 9 7 V 9 W Y
13 29

MANUFAC/BODY CODE 1 2 2 2 8
30 34

MAKE/MODEL CODE 1 3 1 1
38

MODEL YEAR 1 9 9 8
39 42

VEHICLE MASS (kg) 0 0 1 7 5 4
43 48

ODOMETER (km) 8 8 8 8 8 8
(ENTER 9'S IF UNKNOWN) 49 54
(ENTER 8'S IF ELECTRONIC)

NUMBER OF OCCUPANTS 0 1
(ENTER 9'S IF UNKNOWN) 56

TRAVELING SPEED (km/h) 9 9 9
59

- (000) PARKED OR STOPPED
(995) JUST STARTING UP
(996) BACKING UP
(997) SPEED NOT EXCESSIVE (BUT UNKNOWN)
(998) SPEED EXCESSIVE (BUT UNKNOWN)
(999) UNKNOWN

STOLEN VEHICLE

- (0) NO
(1) YES
(8) NOT COLLECTED
(9) UNKNOWN

8
62

BODY STRUCTURE

- (1) BODY & FRAME
(2) UNITIZED
(3) INTEGRAL-STUB FRAME
(4) BODY & PLATFORM FRAME
(E.G. VW BUG)
(5) PARTIALLY UNITIZED
(7) OTHER: _____
(9) UNKNOWN

2
63

TRANSMISSION

- (0) NONE
(1) AUTOMATIC
(2) MANUAL
(9) UNKNOWN

1
64

LOCATION OF TRANSMISSION SELECTOR LEVER

- (1) FLOOR
(2) CONSOLE
(3) COLUMN
(7) OTHER: _____
(9) UNKNOWN

2
65

STEERING

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
66

BRAKES

- (1) POWER
(2) MANUAL
(9) UNKNOWN

1
67

VEHICLE TYPE

PASSENGER VEHICLE

- (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR)
(12) 2-DOOR SEDAN OR COUPE
(ANY UPPER B-PILLAR)
(13) 4-DOOR HARDTOP
(14) 4-DOOR SEDAN
(15) STATION WAGON
(16) CONVERTIBLE
(18) OTHER PASS. VEH. : _____
(19) PASSENGER VEHICLE, TYPE UNKNOWN

MULTIPURPOSE PASSENGER VEHICLE

- (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO)
(22) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
(23) VAN, SIZE UNKNOWN
(24) VAN, SMALL (MINI)
(25) VAN, LARGE
(29) MPV, TYPE UNKNOWN
(30) MOTOR HOME

TRUCK

- (31) PICKUP TRUCK, UNKNOWN
(32) PICKUP TRUCK, SMALL (DOWNSIZED)
(33) PICKUP TRUCK, LARGE

(99) UNKNOWN

14
60 61

TYPE OF BRAKES

- (1) DRUM, ALL WHEELS
- (2) DISC, FRONT WHEELS
- (3) DISC, ALL WHEELS
- (9) UNKNOWN

3
68

WHEELBASE (cm)
(999) Unknown

277
76 77 78

BRAKE ANTI-LOCK DEVICE

- (0) NONE INSTALLED
- (1) TWO-WHEEL
- (2) FOUR-WHEEL
- (7) EQUIPPED, UNKNOWN WHEELS
- (9) UNKNOWN

2
69

PLASTIC ANTI-LACERATIVE
INNER LAYER GLASS EQUIPPED

- (0) NONE
- (1) WINDSHIELD
- (2) WINDSHIELD AND SIDE
- (7) OTHER
- (9) UNKNOWN

0
79

AIR CONDITIONING IN VEHICLE

- (0) NO
- (1) YES
- (8) NOT COLLECTED
- (9) UNKNOWN

8
70

TYPE OF DRIVE

- (1) REAR WHEEL
- (2) FRONT WHEEL
- (3) FOUR WHEEL
- (4) ALL WHEEL DRIVE
- (9) UNKNOWN

2
71

FIELD INVESTIGATOR INSTRUCTIONS:

1. INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.
2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE.
3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR.
4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE.

EXAMPLES:

DUAL REAR WHEELS

- (0) NO
- (1) YES
- (9) UNKNOWN

0
72

ORIGINAL TYPE
OF RESTRAINT SYSTEM

- (1) ACTIVE BELT
- (2) PASSIVE BELT
- (3) AIRBAG
- (4) KNEE BOLSTERS
- (7) OTHER: _____
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

3
73

EQUIPPED WITH ROLL BAR

- (0) NO
- (1) YES
- (9) UNKNOWN


0
74

TYPE OF ROOF


- (0) NONE
- (1) SOLID
- (2) T-TOP CLOSED
- (3) T-TOP OPEN
- (4) SUN ROOF CLOSED
- (5) SUN ROOF OPEN
- (6) CONVERTIBLE CLOSED
- (7) CONVERTIBLE OPEN
- (8) OTHER: _____
- (9) UNKNOWN

1
75

FRONT OR REAR

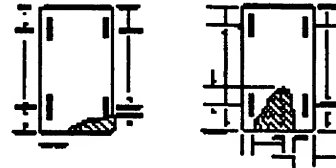

SIDE

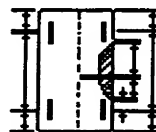

ROOF (REFERENCE TO
TOP OF DOOR SILL
OR WINDOW SILL)



Duplicate columns 1-8
from the previous card.



Module V D Format 0 2
9 10 11 12

VEHICLE DESCRIPTION VD-3

ORIGINAL SPECIFICATIONS

Wheelbase	<u>277</u> cm	Front Overhang	<u>114</u> cm
Curb Weight	<u>1754</u> kg	Rear Overhang	<u>139</u> cm
Average Track Width	<u>158</u> cm	Undeformed End Width (UEW)	<u>160</u> cm
Overall Length	<u>530</u> cm	Engine Displacement	<u>4.6</u> L
Overall Width (OAW)	<u>187</u> cm	Engine: # of Cylinders	<u>08</u>

VEHICLE DAMAGE

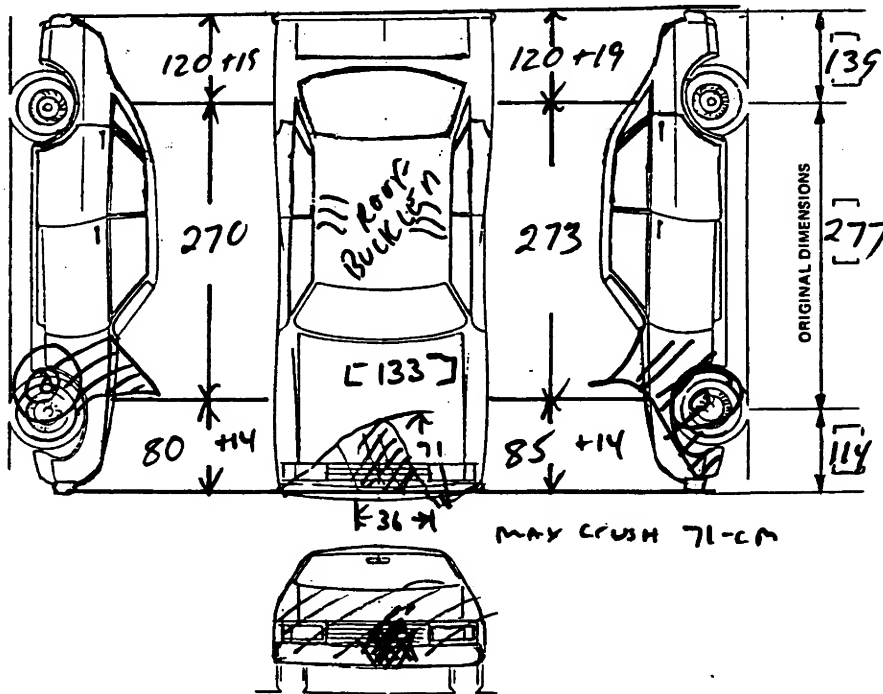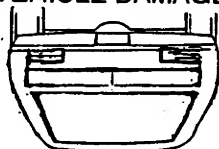

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more
Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 999 m

Front-End Overlap (Percent) = $\frac{DDL}{UEW}$

99 %

Vehicle Overlap (Percent) = $\frac{DDL + 1/2 (OAW - UEW)}{OAW}$

99 %

Duplicate columns 1-8
from the previous card.

Module D A Format 0 2
9 10 11 12

DAMAGE DA-1

PRIMARY	CASE VEHICLE PRIMARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>1</u> 13	Tree
IMPACT SPEED (km/h)	<u>999</u> 14 15 16	<u>998</u> 35 36 37
ESTIMATED BY	<u>1</u> 17	<u>1</u> 38
CRUSH (cm)	<u>071</u> 18 19 20	<u>998</u> 39 40 41
CDC #1	<u>12-FCE N 3</u> 21 27	<u>98-0000-0</u> 42 48
CDC #2	<u>98-0000-0</u> 28 34	<u>98-0000-0</u> 49 55

Duplicate columns 1-8
from the previous card.

Module D A Format 0 3
9 10 11 12

SECONDARY	CASE VEHICLE SECONDARY CDC	CONTACTED VEHICLE ASSOCIATED CDC
EVENT NUMBER	<u>8</u> 13	
IMPACT SPEED (km/h)	<u> </u> 14 15 16	<u> </u> 35 36 37
ESTIMATED BY	<u> </u> 17	<u> </u> 38
CRUSH (cm)	<u> </u> 18 19 20	<u> </u> 39 40 41
CDC #1	<u> </u> - <u> </u> - <u> </u> - <u> </u> - <u> </u> 21 27	<u> </u> - <u> </u> - <u> </u> - <u> </u> - <u> </u> 42 48
CDC #2	<u> </u> - <u> </u> - <u> </u> - <u> </u> - <u> </u> 28 34	<u> </u> - <u> </u> - <u> </u> - <u> </u> - <u> </u> 49 55

CODES

EVENT NUMBER

(8) NOT APPLICABLE
(9) UNKNOWN

IMPACT SPEED

(998) NOT APPLICABLE
(999) UNKNOWN

IMPACT SPEED ESTIMATOR

(1) INVESTIGATOR
(2) DRIVER
(3) POLICE
(4) "CRASH" PROGRAM
(5) OTHER COMPUTER PROGRAM
SPECIFY: _____
(7) OTHER: _____
(8) NOT APPLICABLE
(NO VEHICLE/NO IMPACT)

CRUSH

(998) NOT APPLICABLE
(NO VEHICLE/DAMAGE)
(999) UNKNOWN

CDC

(9800000) NOT APPLICABLE
(9900000) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module D A Format 0 1
9 10 11 12

DAMAGE DA-2

MAXIMUM SHEET METAL CRUSH

(cm) (999) UNKNOWN

FRONT 071
13 15

RIGHT SIDE 000
16 18

REAR 000
19 21

LEFT SIDE 000
22 24

ROOF 000
25 27

OTHER 000
28 30

CHRONOLOGICAL SEQUENCE OF DAMAGE/INJURY PRODUCING CRASH EVENTS FOR CASE VEHICLE

NOTE: IF CHRONOLOGICAL ORDER
IS UNKNOWN, EVENT
ORDER IS OPTIONAL.

DO YOU KNOW THIS TABLE
TO BE IN CHRONOLOGICAL ORDER?

(0) NO
(1) YES

1
31

EVENT
NUMBER

IMPACT LOCATION

- (1) ON ROADWAY
- (2) SHOULDER/MEDIAN/GORE
- (3) ON ROADSIDE
- (4) OUTSIDE ROADSIDE
RIGHT-OF-WAY
- (5) OTHER
- (6) OFF ROADWAY, LOC. UNK.
- (9) UNKNOWN

IMPACT
CONFIGURATION

FOR CODES, SEE TABLE
ON PAGE DA-3.

OBJECT/VEHICLE
CONTACTED

FOR CODES, SEE TABLE
ON PAGE DA-4.

1

3
32

17
34

TREE

77
36

#2

—
37

—
39

—
41

#3

—
42

—
44

—
46

#4

—
47

—
49

—
51

#5

—
52

—
54

—
56

#6

—
57

—
59

—
61

#7

—
62

—
64

—
66

CODES FOR
IMPACT CONFIGURATIONFRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND UNKNOWN OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND FRONT OF CONTACTED VEHICLE
- (33) AND SIDE OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

- (99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- (00) NO OBJECT
- (01) - (39) PASSENGER VEHICLE & TRUCK
- (40) - (69) OTHER VEHICLE
- (70) - (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) - (97) OFF-ROADWAY OBJECT

- (98) OTHER (DESCRIBE)
- (99) UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZEWHEELBASE

SUB-MINI	< 2286 mm (< 90")
MINI	2286 - 2412 mm (90" - 94.9")
SUB-COMPACT	2413 - 2539 mm (95" - 99.9")
COMPACT	2540 - 2666 mm (100" - 104.9")
INTERMEDIATE	2667 - 2793 mm (105" - 109.9")
FULL	2794 - 2920 mm (110" - 114.9")
LARGE	2921 - 3174 mm (115" - 124.9")
LIMOUSINE	> 3175 mm (> 125")

MULTIPURPOSE PASSENGER VEHICLE

- (11) SMALL VAN (MINI)
- (12) PICKUP
- (14) SMALL UTILITY (WHEELBASE LESS THAN 107",
E.G. JEEP, BRONCO)
- (15) LARGE UTILITY (WHEELBASE MORE THAN 107",
E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (17) PICKUP CAR WITH CANOPY/SHELL COVER
- (21) MOTOR HOME
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (23) PICKUP CAR WITH SLIDE-IN CAMPER
- (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

BUS

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 - 75 cc
- (52) 76 - 125 cc
- (53) 126 - 250 cc
- (54) 251 - 500 cc
- (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING
ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM
OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE
MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION
- (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION
- (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

Duplicate columns 1-8
from the previous card.

Module C R Format 0 1
9 10 11 12

CRASH RECONSTRUCTION CR-1

for ΔV

	CASE VEHICLE PRIMARY IMPACT			CASE VEHICLE SECONDARY IMPACT		
	CASE VEHICLE	CONTACTED VEHICLE		CASE VEHICLE	CONTACTED VEHICLE	
EVENT NUMBER	<u>1</u> 13			<u>47</u>		
ΔV (km/h) TOTAL	<u>045</u> 14 15 16	<u>8-</u> 32 33 34		<u>48 49 50</u>	<u>66 67 68</u>	
LONGITUDINAL*	<u>-045</u> 17 20	<u>8-</u> 35 38		<u>51 54</u>	<u>69 72</u>	
LATERAL*	<u>+000</u> 21 24	<u>8-</u> 39 42		<u>55 58</u>	<u>73 76</u>	
*NOTE: THESE ΔV COMPONENTS MUST INCLUDE SIGN.						
EXAMPLES: 10 km/h = <u>+010</u> -7 km/h = <u>-007</u>						
ENERGY DISSIPATED BY CRUSH (Kj)	<u>0143</u> 25 28	<u>8-</u> 43 46		<u>59 62</u>	<u>77 80</u>	
RECONSTRUCTION						
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30			<u>63 64</u>		
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL						
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL						
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL						
NOT RECONSTRUCTED BECAUSE						
(02) INSUFFICIENT DATA						
(03) EXCESSIVE UNDERRIDE/ OVERRIDE						
(04) ROLLOVER						
(05) VAULTING						
(06) OTHER TRAVEL IN MORE THAN ONE PLANE						
(07) NON-HORIZONTAL FORCE						
(08) SIDESWIPE-TYPE DAMAGE						
(09) YIELDING OBJECT						
(10) OTHER:						
(11) AT LEAST ONE VEHICLE BEYOND SCOPE						
(12) OTHER VEHICLE NOT INSPECTED						
MODE						
(1) CDC ONLY						
(2) CDC & DETAILED DAMAGE	<u>2</u> 31			<u>65</u>		
(3) TRAJECTORY & CDC						
(4) TRAJECTORY & CDC & DETAILED DAMAGE						
(5) NOT RECONSTRUCTED						
COMPUTER PROGRAM SPECIFY: <u>WINSMAH</u>						

Duplicate columns 1-8
from the previous card.

Module C R Format 0 2
9 10 11 12

CRASH RECONSTRUCTION CR-2

for EBS

	CASE VEHICLE PRIMARY IMPACT			CASE VEHICLE SECONDARY IMPACT		
	CASE VEHICLE	CONTACTED VEHICLE		CASE VEHICLE	CONTACTED VEHICLE	
EVENT NUMBER	<u>1</u> 13			<u> </u> 47		
EBS (km/h) TOTAL	<u>045</u> 14 15 16	<u>8-</u> 32 33 34		<u> </u> 48 49 50	<u> </u> 66 67 68	
LONGITUDINAL*	<u>-045</u> 17 20	<u>8-</u> 35 38		<u> </u> 51 54	<u> </u> 69 72	
LATERAL*	<u>+000</u> 21 24	<u>8-</u> 39 42		<u> </u> 55 58	<u> </u> 73 76	
*NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN.						
EXAMPLES: 10 km/h = ± 0 1 0 -7 km/h = - 0 0 7						
ENERGY DISSIPATED BY CRUSH (Kj)	<u>0143</u> 25 28	<u>8-</u> 43 46		<u> </u> 59 62	<u> </u> 77 80	
RECONSTRUCTION						
(01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL	<u>22</u> 29 30			<u> </u> 63 64		
(21) RECONSTRUCTED, LOW CONFIDENCE LEVEL						
(22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL						
(23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL						
NOT RECONSTRUCTED BECAUSE						
(02) INSUFFICIENT DATA						
(03) EXCESSIVE UNDERRIDE/OVERRIDE						
(04) ROLLOVER						
(05) VAULTING						
(06) OTHER TRAVEL IN MORE THAN ONE PLANE						
(07) NON-HORIZONTAL FORCE						
(08) SIDESWIPE-TYPE DAMAGE						
(09) YIELDING OBJECT						
(10) OTHER: _____						
(11) AT LEAST ONE VEHICLE BEYOND SCOPE						
(12) OTHER VEHICLE NOT INSPECTED						
MODE						
(1) CDC ONLY	<u>2</u> 31			<u> </u> 65		
(2) CDC & DETAILED DAMAGE						
(3) TRAJECTORY & CDC						
(4) TRAJECTORY & CDC & DETAILED DAMAGE						
(5) NOT RECONSTRUCTED						
COMPUTER PROGRAM SPECIFY: <u>WINSMASH</u>						

CRASH RECONSTRUCTION CR-3

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.


Specific Impact No.	Location of Direct Damage	Location of Field L
1	CENTER	BC TO BC

UEW = 160

3-CM BUMPER COVER MATERIAL

PLANE:

- (1) Bumper
(2) Above Bumper
(3) Sill
(4) Above Sill
(5) Other _____
(9) Unknown

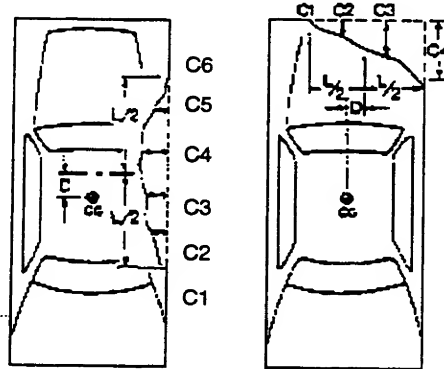

DL _____

UDL _____

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

[illegible]

Duplicate columns 1-8
from the previous card.

Module C R Format 0 4
9 10 11 12

CRASH RECONSTRUCTION CR-4

NOTES:

1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN CENTIMETERS.
2. MEASURE C_1 TO C_6 FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.
3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
4. USE THE CENTER OF THE WHEELBASE AS THE CG.

OTHER VEHICLE

LOCATOR


Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L

NOT APPLICABLE

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other _____
- (9) Unknown

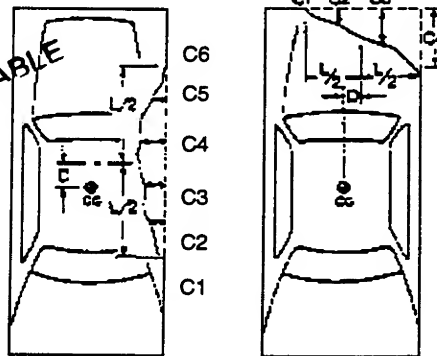

DL _____

UDL _____

CRUSH PROFILE IN CENTIMETERS

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

Specific Impact Number	Plane of Impact C-Measur.	Direct Damage		Field L	C_1	C_2	C_3	C_4	C_5	C_6	$\pm D$
		Length (DDL)	Max Crush								
1											
13	14	15 16 17	18 19 20	21 22 23	24 25 26	27 28 29	30 31 32	33 34 35	36 37 38	39 40 41	42 43 44 45
2											

NOT APPLICABLE

Duplicate columns 1-8
from the previous card.

Module W T Format 0 1
9 10 11 12

WHEELS AND TIRES

WT-1

WHEELS--DAMAGED

- (0) NO
(1) YES
(9) UNKNOWN

LF 0
13

RF 0

RR 0

LR 0
16

SIZE (NOT DOT CODE. IF UNKNOWN, USE 9'S)

LF P22560R16
25

RF _____
35

RR _____
45

LR _____
55

TIRE TREAD TYPE

- (1) REGULAR
(2) SNOW
(3) SLICKS
(4) ALL WEATHER (MS)
(7) OTHER: _____
(9) UNKNOWN

LF 4
17

RF 4

RR 4

LR 4
20

CARCASS CONSTRUCTION

- (1) BIAS
(2) BELTED BIAS
(3) RADIAL
(4) ELLIPTICAL
(5) HI PRESSURE SPARE
(6) SPACE SAVER SPARE
(7) OTHER: _____
(9) UNKNOWN

LF 3
21

RF 3

RR 3

LR 3
24

IF VEHICLE IS EQUIPPED WITH DUAL
WHEELS, COMPLETE FOR OUTER WHEELS
AND MAKE NOTES ON INNER WHEELS.

NOTES: _____

Duplicate columns 1-8
from the previous card.

Module F T Format 0 1
9 10 11 12

FUEL AND FUEL TANKS FT-1

TYPE OF PROPULSIVE FUEL

- (1) GASOLINE
- (2) DIESEL OIL
- (3) LPG
- (4) ELECTRIC
- (7) OTHER: _____
- (9) UNKNOWN

1
13

AUXILIARY TANK TYPE

- (1) OEM TANK
- (2) AFTER MARKET TANK
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

8
21

MAIN TANK LOCATION

RE

322
14 16

AUXILIARY TANK LOCATION

888
22 24

MAIN FILLER CAP LOCATION

133
17 19

AUXILIARY FILLER CAP LOCATION

888
25 27

MAIN TANK MATERIAL

3
20

AUXILIARY TANK MATERIAL

8
28

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F L Format 0 1
9 10 11 12

FUEL LEAKAGE FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

0
13

(1) YES COMPLETE PAGE.

LEAK NUMBER	I LEAKING COMPONENT	II COMPONENT SOURCE	III TYPE OF DAMAGE	IV SEVERITY OF DAMAGE	V LOCATION OF LEAK	EVENT NUMBER
#1	<u> </u> <u> </u> 14 15	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 21
#2	<u> </u> <u> </u> 22 23	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 29
#3	<u> </u> <u> </u> 30 31	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 37
#4	<u> </u> <u> </u> 38 39	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 45
#5	<u> </u> <u> </u> 46 47	<u> </u>	<u> </u>	<u> </u>	<u> </u> <u> </u>	<u> </u> 53

I LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN

- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT (LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT (LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R, RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R & C)
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module F R Format 0 1
9 10 11 12

FIRE FR-1

WAS THERE FIRE IN OR ON CASE VEHICLE?

(0) NO SKIP PAGE.

(1) YES COMPLETE PAGE.

0
13

DID FIRE START IN CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

14

SEVERITY OF FIRE DAMAGE

- (1) MINOR
(2) MODERATE
(3) SEVERE
(9) UNKNOWN

16

FLAME PROPOGATION RATE

- (1) RAPID/EXPLOSIVE
(2) SLOW/MODERATE
(9) UNKNOWN

15

DID AN INJURY TO CASE
VEHICLE OCCUPANT RESULT FROM
FIRE IN OR ON CASE VEHICLE?

- (0) NO
(1) YES
(9) UNKNOWN

17

PROVIDE NOTES IF FIRE OCCURRED.

Duplicate columns 1-8
from the previous card.

Module E D Format 0 1
9 10 11 12

EXTERIOR DAMAGE

ED-1

HOOD PERFORMANCE

FOR THE FOLLOWING, USE CODES:

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

HOOD LATCH(ES)- -RELEASED

9
13

-DAMAGED

1
14

-JAMMED

9
15

HOOD HINGES- -LEFT, DAMAGED

0
16

-LEFT, SEPARATED
(COMPLETE)

8
17

-RIGHT, DAMAGED

0
18

-RIGHT, SEPARATED
(COMPLETE)

8
19

HOOD REMAINED ON VEHICLE

1
20

REAR EDGE OF HOOD- -ELEVATED

1
21

-CONTACTED WINDSHIELD

1
22

-PENETRATED WINDSHIELD

0
23

HOOD LATCH LOCATION

- (1) FRONT OF VEHICLE
- (2) COWL AREA
- (3) SIDE
- (8) NOT APPLICABLE
- (9) UNKNOWN

1
24

STEERING COL FLEXIBLE COUPLING

FLEXIBLE COUPLING TYPE

- (0) NONE
- (1) FLEXIBLE MATERIAL
- (2) POT
- (3) SINGLE U-JOINT
- (4) DOUBLE U-JOINT
- (5) FLEXIBLE CABLE
- (6) COMBINATION OF ABOVE
(CIRCLE EACH)
- (7) OTHER: _____
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN, IF EQUIPPED

9
26

COUPLING-

-DAMAGED

9
27

(USE CODES
FROM HOOD
PERFORMANCE)

-SEPARATED
(COMPLETE)

9
28

ENG COMPART TELESCOPING UNIT

TYPE OF UNIT

- (00) NONE INSTALLED
- (01) - (07) SEE UNITS ON PAGE ED-2
- (88) NOT COLLECTED
- (97) OTHER: _____
- (98) EQUIPPED, TYPE UNKNOWN
- (99) UNKNOWN IF EQUIPPED

8 8
29 30

ORIGINAL LENGTH (mm)

F (OR H): _____

TELESCOPED LENGTH (mm)

G: _____

DIFFERENCE (mm)

F (OR H) - G

(IF LESS THAN 15mm, ENTER "000".)

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO
COMPRESSION
- (992) COMPRESSED, AMOUNT
UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT
EQUIPPED)
- (999) UNKNOWN

8 8 8
31 32 33

ENGINE OR TRANSMISSION MOUNT

SEPARATION (COMPLETE)

- (0) NO
- (1) YES
- (9) UNKNOWN

0
25

LEFT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

8
 34

LEFT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
 (2) DOOR-LATCH SEPARATION
 (3) LATCH-STRIKER SEPARATION
 (4) STRIKER-PILLAR SEPARATION
 (5) BODY DISTORTION
 (6) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (7) OPENED, REASON UNKNOWN

- (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

LEFT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

4
 35

LOWER

0
 36

-B-PILLAR, UPPER

0
 37

LOWER

0
 38

-C-PILLAR, UPPER

0
 39

LOWER

0
 40

-D-PILLAR, UPPER

8
 41

LOWER

8
 42

-FRONT

0
 43

-REAR

0
 44

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

0
 45

-REAR

0
 46

REAR DOOR

REAR DOOR TYPE

- (0) NO DOOR (INCLUDES PICKUPS)
- (1) HATCHBACK
- (2) ONE-WAY TAILGATE
- (3) TWO-WAY TAILGATE
- (4) CLAMSHELL/DISAPPEARING TAILGATE
- (5) SINGLE DOOR
- (6) DOUBLE DOOR
- (9) UNKNOWN

Hatchback



One-way



Two-way



or



Clamshell



Single door



Double door

HOW DID DOOR
OPEN DURING COLLISION?

- (0) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (1) HINGE AREA SEPARATION
- (2) DOOR-LATCH SEPARATION
- (3) LATCH-STRIKER SEPARATION
- (4) STRIKER-PILLAR SEPARATION
- (5) BODY DISTORTION
- (6) COMBINATION OF ABOVE
(CIRCLE EACH)
- (7) OPENED, REASON UNKNOWN
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

DOOR JAMMED CLOSED

- (0) NO
- (1) YES
- (8) NOT APPLICABLE (NO DOOR)
- (9) UNKNOWN

0
47

8
48

8
49

OTHER REAR DAMAGE

WAS PARTITION TO LUGGAGE AREA
DAMAGED DURING COLLISION?

- (0) NO
- (1) YES
- (8) NOT APPLICABLE
- (9) UNKNOWN

0
50

SPARE TIRE

- (0) NO SPARE TIRE
- (1) NOT ATTACHED BEFORE COLLISION
- (2) ATTACHED, NOT SEPARATED IN COLLISION
- (3) ATTACHED, SEPARATED DUE TO COLLISION
- (8) NOT COLLECTED
- (9) UNKNOWN

8
51

TRAILER HITCH TYPE

- (0) NO HITCH

BALL-AND-SOCKET TYPES

- (1) TEMPORARY FRAMEWORK (E.G. RENTAL CLAMP-ON)
- (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK)
- (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING)
- (4) LOAD EQUALIZING

OTHER TYPES

- (5) RING-AND-PINTLE
- (6) FIFTH-WHEEL (INCL P/U)
- (7) OTHER (E.G. CLEVIS-AND-PIN)
- (8) EQUIPPED, TYPE UNKNOWN
- (9) UNKNOWN IF EQUIPPED

0
52

TRAILER TYPE
(AT TIME OF COLLISION)

- (0) NO TRAILER
- (1) TRAVEL-TRAILER/CAMPER
- (2) MOBILE HOME
- (3) BOAT/SNOWMOBILE/ATV TRAILER
- (4) UTILITY TRAILER
- (5) TOWED CAR
- (7) OTHER: _____
- (8) TRAILER, TYPE UNKNOWN
- (9) UNKNOWN

0
53

RIGHT-SIDE BODY MOUNT

DID BODY MOUNT SEPARATE?

- (0) NO
 (1) YES
 (8) NOT APPLICABLE
 (9) UNKNOWN

8
 54

RIGHT DOORS

HOW DID DOORS
OPEN DURING COLLISION?

USE CODES:

(00) DOOR DID NOT OPEN

OPENED BECAUSE OF

- (01) HINGE AREA SEPARATION
 (02) DOOR-LATCH SEPARATION
 (03) LATCH-STRIKER SEPARATION
 (04) STRIKER-PILLAR SEPARATION
 (05) BODY DISTORTION
 (06) COMBINATION OF ABOVE
 (CIRCLE EACH)
 (07) OPENED, REASON UNKNOWN
 (11) VAN RIGHT-REAR DOOR OPENED
 (ANY MECHANISM)

(98) NOT APPLICABLE (NO DOOR)

(99) UNKNOWN

RIGHT PILLARS

PILLARS SEPARATED COMPLETELY -

USE CODES:

- (0) NO
 (1) YES
 (4) NO SEPARATION, BUT DAMAGED
 (8) NOT APPLICABLE (NOT EQUIPPED)
 (9) UNKNOWN

-A-PILLAR, UPPER

4
 55

LOWER

4
 56

-B-PILLAR, UPPER

0
 57

LOWER

0
 58

-C-PILLAR, UPPER

0
 59

LOWER

0
 60

-D-PILLAR, UPPER

8
 61

LOWER

8
 62

-FRONT

00
 63 64

-REAR

00
 65 66

DOORS JAMMED CLOSED-

USE CODES:

- (0) NO
 (1) YES
 (8) NOT APPLICABLE (NO DOOR)
 (9) UNKNOWN

-FRONT

1
 67

-REAR

0
 68

VAN REAR DOOR TYPE

- (0) VAN, NO REAR DOOR
 (1) TRACK (SLIDING) - RIGHT SIDE
 (2) SINGLE-HINGED - RIGHT SIDE
 (3) DOUBLE-HINGED - RIGHT SIDE
 (4) TRACK (SLIDING) - RIGHT & LEFT SIDE
 (5) SINGLE-HINGED - RIGHT & LEFT SIDE
 (6) DOUBLE-HINGED - RIGHT & LEFT SIDE
 (7) TRACK AND HINGED COMBINATION
 (8) NOT APPLICABLE (NOT A VAN)
 (9) UNKNOWN

8
 69

WINDSHIELD DAMAGE

WINDSHIELD CRACKED

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

WINDSHIELD BROKEN
(PLASTIC INTERLAYER TORN)

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

CRACKED OR BROKEN
BY OCCUPANT CONTACT

- (0) NO
(1) YES
(8) NOT APPLICABLE
(9) UNKNOWN

EXTENT OF BOND SEPARATION

- (0) NONE
(1) 1 - 20%
(2) 21 - 40
(3) 41 - 60
(4) 61 - 80
(5) 81 - 99
(6) TOTAL
(7) SEPARATED, AMOUNT
UNKNOWN
(8) NOT APPLICABLE
(9) UNKNOWN

 $\frac{1}{70}$ $\frac{0}{71}$ $\frac{0}{72}$ $\frac{0}{73}$

WINDSHIELD MARK ON CASE VEHICLE:

2

WINDSHIELD CODE

- (97) DESCRIBED BUT NOT CODED
(98) NOT APPLICABLE (NO WINDSHIELD)
(99) UNKNOWN

 $\frac{99}{74 \ 75}$


Roof

DID T-ROOF/SUN ROOF OPEN
DURING COLLISION?

- (0) NO
(1) YES
(8) NOT APPLICABLE
(NOT A T-ROOF OR SUN ROOF)
(9) UNKNOWN

 $\frac{8}{76}$

LOCATE AREA OF WINDSHIELD INTEREST OR DAMAGE WITH DIMENSIONS (VERTICAL & HORIZONTAL) ON THIS DIAGRAM OF THE WINDSHIELD AS VIEWED FROM INSIDE.

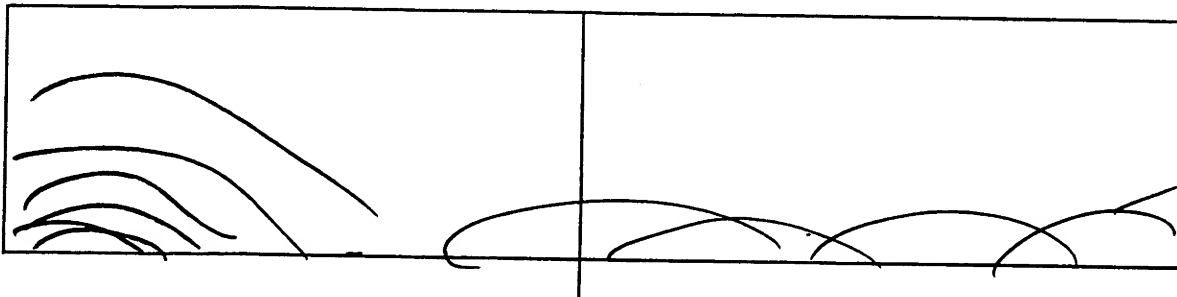

L

C

R

Duplicate columns 1-8
from the previous card.

Module S C Format 0 1
9 10 11 12

STEERING WHEEL AND COLUMN SC-1

STEERING WHEEL

STEERING WHEEL RIM DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN

0
13

NUMBER OF STEERING WHEEL SPOKES

- (9) UNKNOWN

4
14

STEERING WHL SPOKE DAMAGE

- (0) NONE
- (1) DEFORMED SLIGHTLY
- (2) SEVERELY BENT
- (3) BROKEN
- (9) UNKNOWN

0
15

STEERING WHEEL POSITION AT TIME OF COLLISION

IN WHAT O'CLOCK POSITION WAS THE
NORMAL TOP OF THE WHEEL POINTED
WHEN THE COLLISION OCCURRED?

EXAMPLES

O'CLOCK = 1 2



(NORMAL STRAIGHT
AHEAD)

O'CLOCK = 0 2



O'CLOCK = 99


(99) UNKNOWN

STEERING WHEEL ENERGY ABSORBING DEVICE



(1) EXAMPLES:

BARRACUDA, 70 - 74
CHALLENGER, 70 - 74
CAPRI, 71 - 77

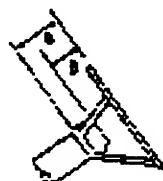

(2) EXAMPLES:

OMNI, 78 -
HORIZON, 78 -

STEERING COLUMN OPTIONS

TILT FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED, UNK POSITION
- (2) UP
- (3) MIDDLE
- (4) LOWER
- (9) UNKNOWN IF EQUIPPED

1
16

SWING-AWAY FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0
17

TELESCOPING FEATURE

- (0) NOT EQUIPPED
- (1) YES, EQUIPPED
- (9) UNKNOWN IF EQUIPPED

0
18

TYPE OF DEVICE

- (0) NONE
- (1) CONVOLUTED OR MESH CYLINDER
- (2) DEEP DISH STEERING WHEEL
- (7) OTHER: _____
- (8) NOT COLLECTED
- (9) UNKNOWN IF EQUIPPED

8
19

ORIGINAL DIMENSION (mm)

A: _____

DAMAGE DIMENSION (mm)

B: _____

DIFFERENCE (mm)

A - B

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT COMPRESSION
- (992) COMPRESSED, AMOUNT UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO MEASURE
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

8 8 8
20 22

STEERING WHEEL AND COLUMN SC-2

STEERING COLUMN ENERGY ABSORBING DEVICE

TYPE OF DEVICE * (IF 27 OR 28)

- (00) NOT EQUIPPED
- (88) NOT COLLECTED
- (99) UNKNOWN

ORIGINAL LENGTH (mm)

C: _____

COMPRESSED LENGTH (mm)

D: _____

BRACKET DEFLECTION (IF CODE 36, 48,
OR 49 ABOVE)

OR

COMPRESSION (OR EXTRUSION) (mm)

C - D (OR E) (TOLERANCE: ±10)


- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT
COMPRESSION
- (992) COMPRESSED, AMOUNT UNKNOWN
- (993) DEVICE EXTENDED
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

* (ADD A & B FOR TOTAL COMPRESSION)

SHEAR CAPSULE SEPARATION (mm)

S (USE AVG. OF LEFT & RIGHT CAPSULES.)

LT:

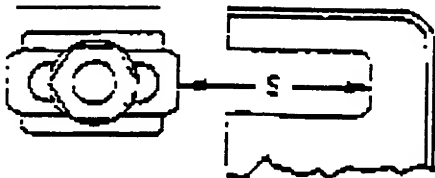

RT:

- (888) NOT COLLECTED
- (991) NOT MEASURED/NO APPARENT
SEPARATION
- (992) SEPARATED, AMOUNT UNKNOWN
- (997) UNABLE TO BE MEASURED
- (998) NOT APPLICABLE (NOT EQUIPPED)
- (999) UNKNOWN

COLUMN VERTICAL ROTATION

- (0) NO APPARENT ROTATION
- (1) UPWARD APPARENT ROTATION
- (2) DOWNWARD APPARENT ROTATION
- (9) UNKNOWN

COLUMN LATERAL ROTATION

- (0) NO APPARENT ROTATION
- (1) LEFT APPARENT ROTATION
- (2) RIGHT APPARENT ROTATION
- (9) UNKNOWN

STEERING WHEEL (CONTINUED)

STEERING WHEEL HUB DAMAGE

- (0) NONE
- (1) OCCUPANT CONTACT
- (2) AIRBAG
- (3) OTHER _____
- (9) UNKNOWN

33

8 8
23 24

8 8 8
25 27

8 8 8
28 30

31

32



INTRUSION IT-1

[illegible]


OCCUPANT CONTACT WORKSHEET

Contact	Interior Component Contacted	Occupant No. if Known	Body Region if Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	GAS PEDAL	1	FOOT	BENT	1
B	KNEE BOLTER	1	KNEE	SCUFF (RT)	1
C	KNEE BOLTER	1	KNEE	SCUFF (LT)	1
D	UPPER IP	1	HAND	SCUFF (LT)	2
E	COUNTER STALL	1	HAND	SCUFF	2
F	AIRBAG	1	FACE	LIPSTICK	1
G					
H					
I					
J					

VEHICLE OCCUPANT CONTACT DIAGRAM

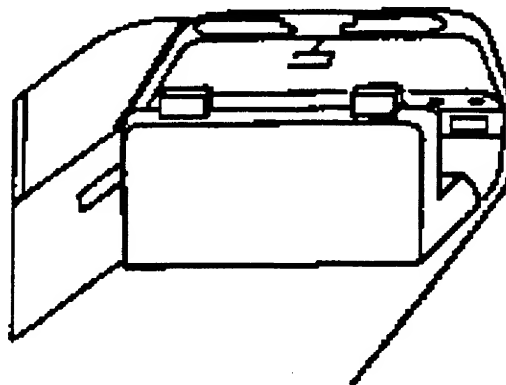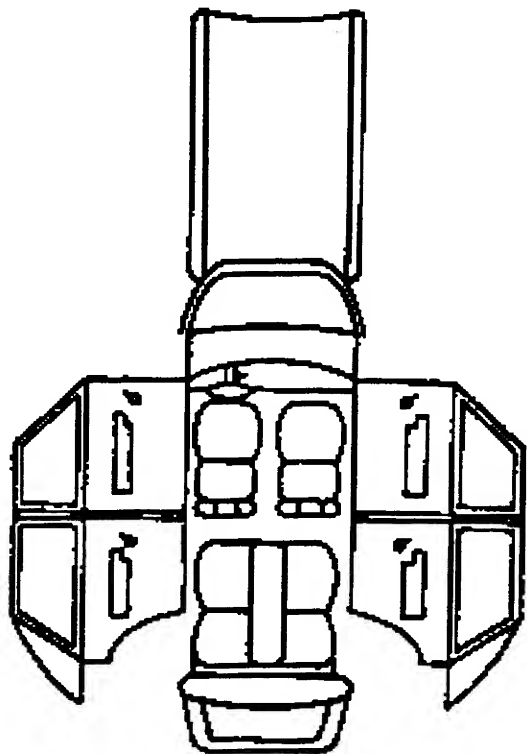

DR BELT: Adjusted Up
clothing transfers on lap-belt
webbing.
nothing on D-ring or latch

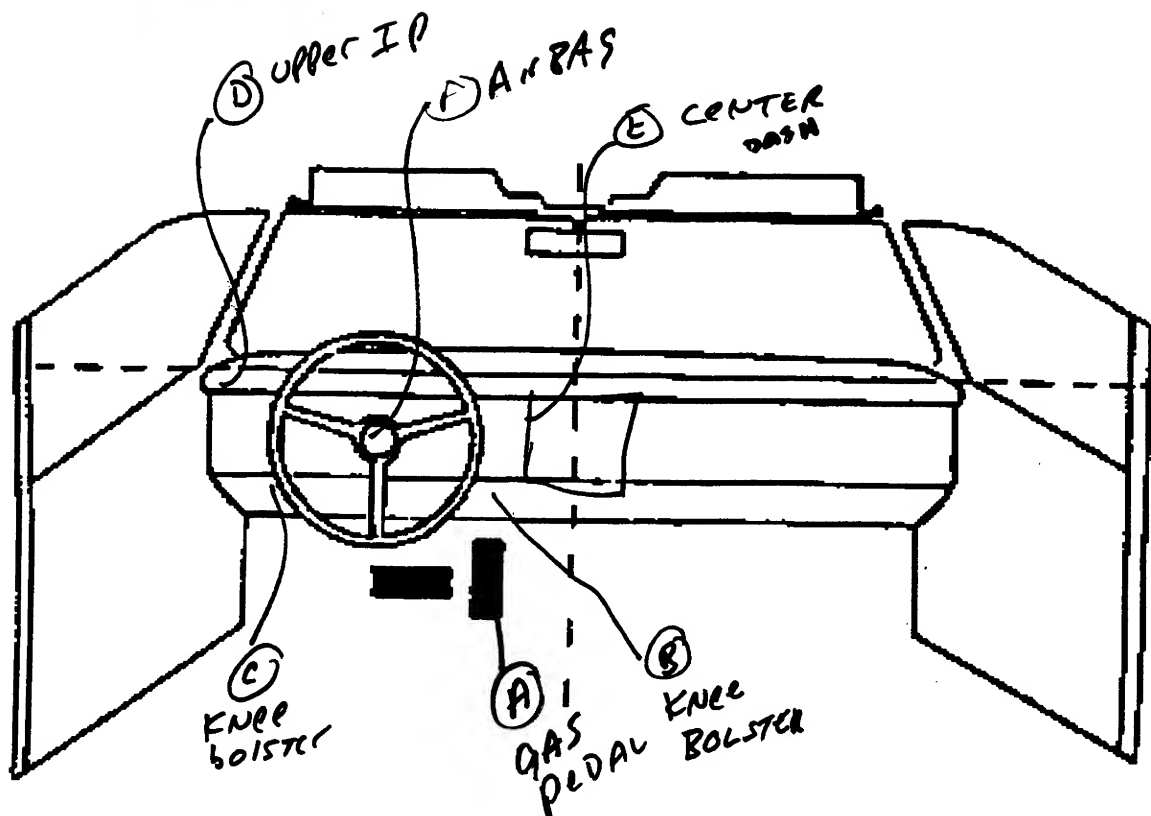

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.

- (1) LEFT (3) RIGHT INDIVIDUAL SEAT
- (1) LEFT (2) CENTER (3) RIGHT BENCH: FULL WIDTH 3 PASSENGER
- (1) LEFT (2) LEFT CENTER (6) RIGHT CENTER (3) RIGHT BENCH: FULL WIDTH 4 PASSENGER
- (1) LEFT (2) CENTER (5) RIGHT & BENCH: PARTIAL WIDTH, LEFT AISLE SPACE
- (0) LEFT & SPACE (2) CENTER (5) RIGHT & BENCH: PARTIAL WIDTH, CENTERED SPACE
- (4) ENTIRE VEHICLE WIDTH CARGO AREA

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR
5 PASSENGERS

X	X	11	13
X	X	X	21 22 23

VAN
12 PASSENGER CAPACITY

X	X	11	13
X	X	X	21 22 25
X	X	X	31 32 35
X	X	X	X 41 42 46 43

CODES FOR COLUMN F, MEASUREMENT AXIS

- (X) X-AXIS (FORE & AFT)
(Y) Y-AXIS (LATERAL)
(Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

OCCUPANT NUMBER	INJURY NUMBER	CONTACT
(00)	(00)	NO CONTACT
(##)	(00)	CONTACT, NO INJURY
(97)	(99)	CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN
(99)	(00) OR (99)	UNKNOWN IF CONTACT

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/
SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE
SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (*DESCRIBE*)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER
COMPARTMENT BUT PART
OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (E.G. *SPARE TIRE*,
JACK. DESCRIBE.)
- (49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

*USE ONLY IF ALL THESE COMPONENTS
INTRUDED INTO A SINGLE OCCUPANT SPACE.*

- | | |
|------------------------|-------------------------|
| (50) WINDSHIELD HEADER | (60) ROOF |
| A-PILLAR | ROOF RAIL |
| ROOF SIDE RAIL | A-PILLAR |
| | B-PILLAR |
| (51) INSTRUMENT PANEL | C-PILLAR |
| A-PILLAR | WINDOW FRAME |
| DOOR PANEL | DOOR PANEL |
| | FLOOR PAN |
| (52) INSTRUMENT PANEL | (61) INSTRUMENT PANEL |
| A-PILLAR | TOE PAN |
| WINDSHIELD HEADER | WINDSHIELD HEADER |
| (53) DOOR PANEL | A-PILLAR |
| B-PILLAR | ROOF RAIL |
| ROOF RAIL | WINDOW FRAME |
| | DOOR PANEL |
| (54) DOOR PANEL | ROOF |
| A-PILLAR | (62) ROOF |
| ROOF RAIL | ROOF RAIL |
| (55) INSTRUMENT PANEL | C-PILLAR |
| FLOOR PAN | WINDOW FRAME |
| A-PILLAR | FLOOR PAN |
| DOOR FRAME | SECOND SEAT |
| | DOOR PANEL |
| (56) ROOF RAIL | (63) ROOF RAIL |
| A-PILLAR | ROOF |
| B-PILLAR | B-PILLAR |
| WINDOW FRAME | WINDOW FRAME |
| (57) ROOF RAIL | FLOOR PAN |
| A-PILLAR | DOOR PANEL |
| B-PILLAR | SECOND SEAT |
| C-PILLAR | FRONT SEAT |
| DOOR PANEL | (64) ROOF RAIL |
| (58) ROOF | ROOF OR CONVERTIBLE TOP |
| ROOF RAIL | A-PILLAR |
| WINDOW FRAME | B-PILLAR |
| DOOR PANEL | WINDOW FRAME |
| | WINDOW HEADER |
| (59) BACKLIGHT HEADER | (65) WINDSHIELD |
| ROOF | WINDSHIELD HEADER |
| C-PILLAR | ROOF SIDE RAIL |
| THIRD SEAT-BACK | (66) WINDSHIELD |
| | WINDSHIELD HEADER |
| | A-PILLAR |
| | (98) NOT APPLICABLE |
| | (99) UNKNOWN |

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 1
9 10 11 12

INTRUSION IT-5

WAS THERE OCCUPANT COMPARTMENT INTRUSION? 0

13

WAS INTRUSION CATASTROPHIC?

14

- (0) NO DO NOT ANSWER NEXT QUESTION. SKIP PAGE.
(1) YES ANSWER NEXT QUESTION.
(9) UNKNOWN SKIP PAGE.

- (0) NO COMPLETE PAGE.
(1) YES SKIP PAGE.

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 2
9 10 11 12

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

NOTE: USE ADDITIONAL PAGE IF MORE THAN 7 INTRUSIONS.

Duplicate columns 1-8
from the previous card.

Module 1 1 Format 0 3
9 10 11 12

NOTE: IF NO SIDE DOOR INTRUSION,
SKIP REMAINDER OF PAGE.

**SIDE DOOR INTRUSION
RESULTED FROM**

INTRUSION
NUMBER CAUSE

CODES
FOR CAUSE:

- | | | |
|----|----|-----------------------|
| 13 | 15 | (1) DIRECT
IMPACT |
| 16 | 18 | (2) INDUCED
DAMAGE |
| 19 | 21 | (9) UNKNOWN |

**IF DAMAGE TO DOOR COMPONENT RESULTED IN INCREASED
DOOR INTRUSION, CODE COMPONENT**

INTRUSION
NUMBER

DAMAGED
COMPONENT 1

DAMAGED
COMPONENT 2

CODES
FOR COMPONENTS

A
22 23

—

25

B
26 27

—

29

C
30 31

—

33

D
34 35

—

37

- (0) NONE
(1) A-PILLAR
(2) B-PILLAR
(3) C-PILLAR
(4) LATCH/STRIKER
(5) HINGES
(7) OTHER:
(8) NOT APPLICABLE
(9) UNKNOWN

Duplicate columns 1-8
from the previous card.

Module 1 T Format 0 2
9 10 11 12

INTRUSION IT-6

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

- ADDITIONAL PAGE -

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.
CODES FOR B, F, G, H, I, J ON PAGE IT-3
CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

A	B	C	D	E	F	G	H	I	J	K
INTRUSION NUMBER	OCC. SPACE NO.	INTRUDING COMPONENT OR OBJECT	ASSOC. EVENT NO.	MAXIMUM INTRUSION X AXIS (cm)	MAXIMUM INTRUSION Y AXIS (cm)	MAXIMUM INTRUSION Z AXIS (cm)	OCCUPANT NUMBER	INJURY NUMBER	OCCUPANT NUMBER	INJURY NUMBER
13-14	15-16	17-18	19	20-21	22-23	24-25	26-27	28-29	30-31	32-33
<u>0 8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>0 9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 6</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 7</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 8</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>1 9</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 0</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 1</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 2</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 3</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 4</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —
<u>2 5</u>	— —	— —	—	— —	— —	— —	— —	— —	— —	— —

Duplicate columns 1-8
from the previous card.

Module 1 D Format 0 1
9 10 11 12

INTERIOR DAMAGE

ID-1

CODES:

- | | |
|------------------------------|-------------------------------|
| (0) NO | (4) YES, and OCCUPANT CONTACT |
| (1) YES | (8) NOT APPLICABLE |
| (3) NO, and OCCUPANT CONTACT | (9) UNKNOWN |

	LEFT	RIGHT				
SIDES			FRONT		INSTRUMENT PANEL	
FRONT DOOR	0 13	0 14	FOOT CONTROLS	4 45	UPPER PANEL	3 55
FRONT HARDWARE	0 15	0 16	IGNITION KEYS	0 46	MID PANEL	0 56
FRONT ARMREST	0 17	0 18	REAR VIEW MIRROR	1 47	LOWER PANEL	4 57
FRONT GLASS	0 19	0 20	SUNVISOR/FITTINGS	0 48	ASHTRAY	0 58
REAR DOOR AREA	0 21	0 22	(5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES		CONTROL KNOBS & LEVERS	0 59
REAR HARDWARE	0 23	0 24	WINDSHIELD TOP MOLDINGS	0 49	GLOVE COMPARTMENT AREA	1 60
REAR ARMREST	0 25	0 26	LEFT A-PILLAR (UPPER OR LOWER)	0 50	INSTRUMENTS	0 61
REAR GLASS	0 27	0 28	RIGHT A-PILLAR (UPPER OR LOWER)	0 51	PARKING BRAKE RELEASE	0 62
ROOF SIDE RAIL	0 29	0 30	CENTER CONSOLE	1 52	PARKING BRAKE PEDAL	0 63
B-PILLAR	0 31	0 32	TRANSMISSION SELECTOR LEVER	0 53	A/C OR UPPER VENT OUTLETS	0 64
C-PILLAR	0 33	0 34	RIM, HORN, SPOKE	0 54	HEATER OR A/C DUCTS	0 65
D-PILLAR	8 35	8 36			RADIO	0 66
HEADLINING	1 37	1 38			OTHER: * _____	8 67
ROOF STRUCTURE	1 39	1 40				
T-ROOF/SUN ROOF	8 41	8 42				
OTHER: * _____	8 43	8 44				
					REAR	
					WINDOW	0 68
					WINDOW HEADER	0 69
					CONSOLES	
					VERTICAL	8 70
					ROOF	0 71

* MORE THAN ONE ITEM MAY BE NOTED.

Duplicate columns 1-8
from the previous card.

Module S T Format 0 2
9 10 11 12

SEATS

ST-1

FRONT SEAT		DRIVER	PASSENR	FRONT SEAT-BACK		DRIVER	PASSENR
TYPE OF FRONT SEAT (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (97) OTHER: _____ (99) UNKNOWN		<u>05</u> 13 14	<u>05</u> 15 16	SEAT-BACK TYPE (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>3</u> 30	<u>3</u> 31
TYPE OF SEAT MOUNT (1) STANDARD (2) PEDESTAL (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 17	<u>1</u> 18	SEAT-BACK LOCK TYPE (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>3</u> 32	<u>3</u> 33
SWIVEL MECHANISM EQUIPPED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 19	<u>0</u> 20	LOCKS HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 34	<u>1</u> 35
ORIGINAL EQUIPMENT SEATS (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 21	<u>1</u> 22	RECLINER MECHANISM HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 36	<u>1</u> 37
CONTACT OF SEAT BY REAR OCCUPANT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>8</u> 23	<u>8</u> 24	HEAD RESTRAINT HEAD RESTRAINT TYPE (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 38	<u>1</u> 39
FRONT SEAT DAMAGE (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 25	<u>0</u> 26	REMOVED PRE-CRASH (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 40	<u>0</u> 41
CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED		<u>1</u> 27		ADJUSTMENT AT CRASH (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN		<u>2</u> 42	<u>2</u> 43
FRONT SEAT ROTATION (0) NONE APPARENT (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY _____ (8) NOT APPLICABLE (9) UNKNOWN		<u>1</u> 28	<u>0</u> 29	HEAD RESTRAINT DAMAGE (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 44	<u>0</u> 45

FRONT SEAT ADJUSTMENT		DRIVER	PASSENGER	SECOND SEAT (CONT.)	
SEAT ADJUSTMENT TYPE				CENTER ARMREST DAMAGED	
(0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: _____ (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN		<u>2</u> 46	<u>2</u> 47	<u>0</u> 60	
ADJUSTMENT PROVIDED		<u>3</u> 48	<u>3</u> 49		
(1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN					
SEAT ADJUSTER DAMAGE <i>pushed forward</i>		<u>2</u> 50	<u>9</u> 51	SECOND SEAT-BACK	
(0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: _____ (8) NOT APPLICABLE (9) UNKNOWN				LEFT	RIGHT
SEAT ADJUSTER SEPARATION				LOCKS	
(0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 52	<u>0</u> 53	FOR THE FOLLOWING, USE:	
PRE-CRASH POSITION		<u>1</u> 54	<u>2</u> 55	(0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN	
(1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN				LEFT OR CENTER, EQUIPPED	
				<u>8</u> 61	<u>8</u> 62
				<u>8</u> 63	<u>8</u> 64
				<u>8</u> 65	<u>8</u> 66
				<u>8</u> 67	<u>8</u> 68
				LEFT OR CENTER, HELD	
				(3) SEAT FOLDED DOWN	
				RIGHT, EQUIPPED	
				RIGHT, HELD	
				(3) SEAT FOLDED DOWN	
SECOND SEAT		LEFT	RIGHT	THIRD SEAT	
TYPE OF SECOND SEAT				EQUIPPED	
(0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN		<u>1</u> 56	<u>1</u> 57	<u>0</u> 69	
SECOND SEAT DAMAGE				BACKREST DAMAGED	
(0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN		<u>0</u> 58	<u>0</u> 59	<u>8</u> 71	
				<u>8</u> 72	
				<u>8</u> 73	
				<u>8</u> 74	
				VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS	
				(0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN	
				Applies to any rear-seat position	
				<u>1</u> 75	

Duplicate columns 1-8
from the previous card.

Module A B Format 0 1
9 10 11 12


AIRBAG AB-1

<p>DRIVER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 13</p> <p><u>1</u> 14</p>	<p>PASSENGER SIDE</p> <p>LOCATION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>EQUIPPED</p> <p>(0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>DEPLOYED</p> <p>(0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 16</p> <p><u>1</u> 17</p>
<p>CONDITION OF AIRBAG</p> <p>STEERING WHEEL</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 15</p>	<p>CONDITION OF AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>(0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER _____ (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION</p>	<p><u>0</u> 18</p>
<p></p>	<p></p>	<p></p>	<p></p>
<p>DRIVER SIDE</p> <p>AIRBAG</p> <p>STEERING WHEEL</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>1</u> 19</p> <p><u>1</u> 20</p>	<p>PASSENGER SIDE</p> <p>AIRBAG</p> <p>INSTRUMENT PANEL (GLOVE BOX)</p> <p>TETHER</p> <p>(0) NO (1) YES (6) OTHER _____ (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED</p> <p>MARKED BY CONTACT</p> <p>(0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN</p>	<p><u>0</u> 21</p> <p><u>0</u> 22</p>

AIRBAG NUMBER ON DRIVER SIDE:


NOTE AND DESCRIBE ANY AIRBAG CONTACT OR
DAMAGE ON DIAGRAM BELOW:

NO
VENTS

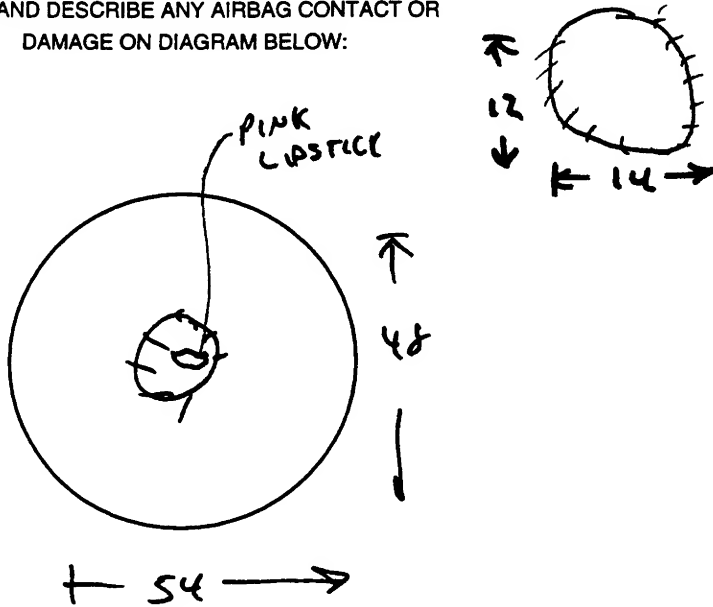

AIRBAG NUMBER ON PASSENGER SIDE:

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR
DAMAGE ON DIAGRAM BELOW:

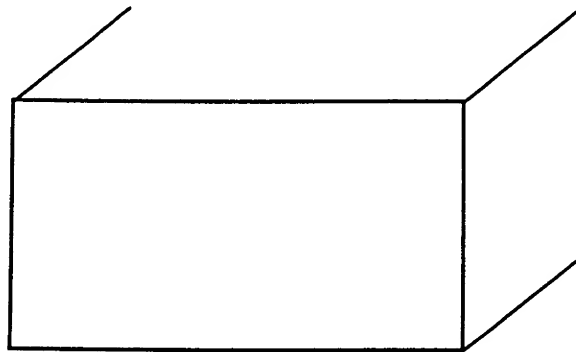

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,
ARE TO BE FILLED IN
FOR EACH CASE VEHICLE OCCUPANT,
WHETHER INJURED OR NOT.

IF THERE IS MORE THAN ONE OCCUPANT,
USE ADDITIONAL COPIES
OF PAGES OC-1, OC-2, OC-3,
AND IC-2 TO DESCRIBE THEM
AND ATTACH THE COPIES TO THIS REPORT.

Duplicate columns 1-8
from the previous card.

Module 0 C Format 0 2
9 10 11 12

OCCUPANT INFORMATION OC-1

OCCUPANT IDENTIFICATION OCCUPANT NUMBER <u>01</u> <small>13 14</small> ROLE OF OCCUPANT AT 1ST IMPACT (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN <u>1</u> <small>15</small>		PHYSICAL DESCRIPTION AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN <u>66</u> <small>20 21</small> AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN <u>25</u> <small>22 23</small> MASS (kg) (999) UNKNOWN <u>175</u> <u>079</u> <small>24 25 26</small> HEIGHT (cm) (999) UNKNOWN <u>5'4</u> <u>163</u> <small>27 28 29</small> SEX (1) MALE (2) FEMALE (9) UNKNOWN <u>2</u> <small>30</small>	
OCCUPANT POSITION ROW LOCATION (1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: _____ (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN <u>1</u> <small>16</small> LATERAL LOCATION (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN <u>1</u> <small>17</small> POSTURE (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD SEAT (65) IN CHILD HARNESS (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: _____ (99) UNKNOWN <u>10</u> <small>18 19</small>		MEDICAL CONDITIONS TREATMENT/MORTALITY (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN <u>03</u> <small>31 32</small> INJURY SEVERITY SCORE (ISS) (99) UNKNOWN <u>05</u> <small>33 34</small> NON-IMPACT MED. CONDITIONS (0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) (6) POST-CRASH NON-FATAL INJURY (7) OTHER: _____ (8) COMBINATION OF ABOVE (CIRCLE EACH) (9) UNKNOWN <u>0</u> <small>35</small>	

OCCUPANT INFORMATION OC-2

MEDICAL CONDITIONS (CONT.)

POLICE INJURY SEVERITY
CODE FOR THIS OCCUPANT

- (0) O - NO INJURY
 (1) C - POSSIBLE INJURY
 (2) B - NON-INCAPACITATING
 (3) A - INCAPACITATING INJURY
 (4) K - FATAL
 (5) INJURED, SEVERITY UNKNOWN
 (6) DIED PRIOR TO IMPACT
 (7) NON-FATAL INJURY,
 SEVERITY UNKNOWN
 (9) UNKNOWN

3
36

CHILD SEAT TYPE

- (00) NONE USED
 (01) YES, USED
 (02) INTEGRAL, Chrysler Mini-van
 (88) NOT APPLICABLE
 (ADULT OR OLDER CHILD)
 (99) UNKNOWN

8 8
41 42

CHILD SEAT MAKE/MODEL

RESTRAINT SYSTEM

ACTIVE RESTRAINT SYSTEM

- (0) NONE
 (1) LAP BELT
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (9) UNKNOWN

3
37

ACTIVE RESTRAINT SYSTEM USAGE

- (0) NONE (AVAILABLE BUT NOT USED)
 (1) LAP BELT ONLY
 (2) SHOULDER HARNESS ONLY
 (3) BOTH LAP BELT &
 SHOULDER HARNESS
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NONE AVAILABLE)
 (9) UNKNOWN

3
38

PASSIVE RESTRAINT SYSTEM

- (0) NONE
 (1) AIRBAG INSTALLED
 (2) PASSIVE UPPER TORSO
 WITH KNEE BOLSTERS
 (3) PASSIVE UPPER TORSO
 WITHOUT KNEE BOLSTERS
 (4) PASSIVE LAP & UPPER TORSO
 (5) AIRBAG INSTALLED &
 PASSIVE RESTRAINT
 (7) OTHER: _____
 (9) UNKNOWN

1
39

PASSIVE RESTRAINT SYSTEM USAGE

- (0) SYSTEM DEFEATED
 (1) AIRBAG NOT DEPLOYED
 (2) AIRBAG DEPLOYED
 (3) AIRBAG NOT REINSTALLED
 (4) PASSIVE UPPER TORSO USED
 (5) PASSIVE LAP & UPPER TORSO USED
 (6) SYSTEM USED IN MANUAL MODE
 (7) IMPROPER USAGE
 (8) NOT APPLICABLE (NOT ORIGINALLY
 EQUIPPED)
 (9) UNKNOWN

2
40

EJECTION

DEGREE OF EJECTION

- (0) NONE
 (1) PARTIAL
 (2) COMPLETE
 (7) EJECTED, DEGREE UNKNOWN
 (9) UNKNOWN IF EJECTED

0
43

AREA OF EJECTION

- (01) WINDOW, LEFT SIDE
 (02) WINDOW, RIGHT SIDE
 (03) WINDOW, REAR
 (04) DOOR, LEFT SIDE
 (05) DOOR, RIGHT SIDE
 (06) DOOR, REAR OR TAILGATE
 (07) WINDSHIELD
 (08) ROOF OR OPEN CONVERTIBLE OR
 FROM EXTERNAL AREA
 (96) EJECTED AREA UNKNOWN
 (97) OTHER AREA: _____
 (98) NOT APPLICABLE (NOT EJECTED)
 (99) UNKNOWN IF EJECTED

9 8
44 45

IF OCCUPANT WAS EJECTED, DESCRIBE
 IN DETAIL BELOW:

HEAD RESTRAINT

HEAD RESTRAINT AVAILABLE
FOR THIS POSITION


- (0) NOT EQUIPPED OR REMOVED
 (1) EQUIPPED
 (9) UNKNOWN

1
46

OCCUPANT INFORMATION OC-3

<p>OCCUPANT EYEWEAR</p> <p>(0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER _____ (8) NOT APPLICABLE (9) UNKNOWN</p> <p><i>BENT AND FLEW OFF</i></p>	<p><u>1</u> 47</p>	<p>SOURCE OF INFORMATION</p> <p>(0) INTERVIEW (1) HOSPITAL (2) AUTOPSY (3) POLICE (4) OTHER _____ (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN</p>	<p><u>0</u> 48</p>
--	------------------------	---	------------------------

INDICATE LOCATION OF INJURIES.

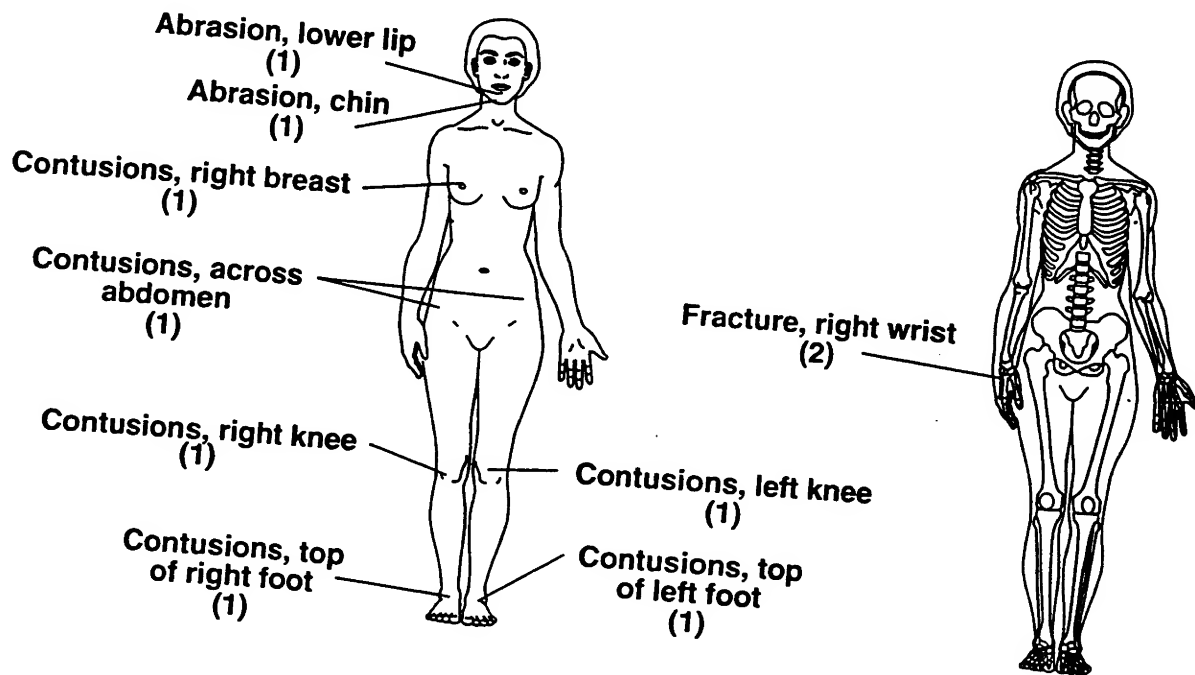

Duplicate columns 1-8
from the previous card.

Module 1 C Format 0 1
9 10 11 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).
Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

					PRIMARY OIC					ASSOCIATED OIC					COMMENTS
OCCUPANT NUMBER	INJURY NUMBER	PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN.		AREA(S) OF POSSIBLE CONTACT 1ST 2ND	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	BODY REGION 1	ASPECT 2	LESION 3	SYSTEM/ORGAN 4	SEVERITY 5	
		17-18	19-20												
13-14	15-16	17-18	19-20	COMMENTS	21	22	23	24	25	26	27	28	29	30	
01	01	87	-	CENTER IP vertical console	F	I	A	I	1	-	-	-	-	-	
	02	87	-		F	I	A	I	1	-	-	-	-	-	
	03	34	87		C	R	C	I	1	-	-	-	-	-	
	04	34	87		M	W	C	I	1	-	-	-	-	-	
	05	86	06		W	R	F	S	2	-	-	-	-	-	
	06	56	-		K	R	C	I	1	-	-	-	-	-	
	07	56	-		K	L	C	I	1	-	-	-	-	-	
	08	28	-		Q	L	C	I	1	-	-	-	-	-	
	09	28	-		Q	R	C	I	1	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	
	-	-	-		-	-	-	-	-	-	-	-	-	-	

NOTE: USE ADDITIONAL PAGES IF NECESSARY.

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

FRONT OF PASSENGER COMPARTMENT

- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (12) WINDSHIELD
- (05) INSTRUMENT PANEL (*SPECIFIC AREA UNKNOWN*)
- (54) UPPER INSTRUMENT PANEL (X)
- (55) MIDDLE INSTRUMENT PANEL (Y)
- (56) LOWER INSTRUMENT PANEL (Z)
- (81) ASH TRAY (*INSTRUMENT PANEL*)
- (02) GLOVE COMPARTMENT AREA
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (57) BENEATH INSTRUMENT PANEL
- (53) PARCEL TRAY
- (48) KNEE RESTRAINT
- (86) VERTICAL CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (09) STEERING ASSEMBLY (*SPECIFIC AREA UNKNOWN*)
- (65) STEERING WHEEL
- (66) STEERING WHEEL COLUMN
- (59) TRANSMISSION LEVER ON COLUMN
- (03) HARDWARE ITEM (*SPECIFIC AREA UNKNOWN*)
- (82) INSTRUMENT(S)
- (83) CONTROL KNOB(S) & LEVER(S) (*FRONT*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (67) IGNITION KEY
- (06) MIRROR
- (04) HEATER OR AIR CONDITIONING DUCTS
- (01) AIR CONDITIONING OR VENTILATION OUTLET(S)
- (08) RADIO (*BUILT IN*)
- (58) ADD-ON TAPE DECK, RADIO, A/C
- (68) ROOF MOUNTED CONTROLS/CONSOLES

REAR

- (88) SURFACE OF REAR INTERIOR
- (23) REAR WINDOW
- (39) REAR WINDOW HEADER
- (50) REAR SEAT CUSHION & BACK

INTERIOR-GENERAL

- (11) TRANSMISSION SELECTION LEVER (*LOCATION UNK.*)
- (59) TRANSMISSION LEVER ON STEERING COLUMN
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (07) PARKING BRAKE HANDLE (*LOCATION UNKNOWN*)
- (84) PARKING BRAKE HANDLE IN FRONT
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (29) FRONT SEAT-BACK(S)
- (51) FRONT SEAT CUSHION
- (50) REAR SEAT CUSHION & BACK
- (49) ARMREST ON SEAT
- (89) UNDER SEAT BOTTOM
- (33) RESTRAINT SYSTEM HARDWARE
- (34) RESTRAINT SYSTEM WEBBING
- (87) AIR CUSHION SKIN (*AIRBAG*)
- (47) AIRBAG (ACRS) COMPARTMENT DOOR/COVER
- (46) AIRBAG GAS
- (48) KNEE RESTRAINT
- (30) HEAD RESTRAINT
- (42) CHILD SEAT RESTRAINTS
- (43) CHILD SEAT
- (31) INTERIOR LOOSE OBJECT
- (32) OTHER OCCUPANT(S)
- (52) INTERNAL FLYING GLASS (*FROM ANY SOURCE*)
- (41) UNKNOWN INTERIOR SURFACE

SIDES

- (20) SURFACE OF SIDE INTERIOR
- (19) HARDWARE ON SIDE OR DOOR
- (13) ARMREST ON SIDE OR DOOR
- (24) COAT HOOK

- (22) WINDOW GLASS (*SIDE*)
- (21) WINDOW FRAMES (*SIDE*)

- (26) ROOF SIDE RAIL

- (14) A-PILLAR
- (15) B-PILLAR
- (16) C-PILLAR
- (17) D-PILLAR

FLOOR

- (40) FLOOR
- (27) CONSOLE ON FLOOR OR BETWEEN SEATS
- (44) TRANSMISSION LEVER ON FLOOR OR CONSOLE
- (85) PARKING BRAKE HANDLE ON FLOOR OR CONSOLE
- (28) FOOT CONTROLS (*INCL. PARKING BRAKE PEDAL*)
- (91) KICKPANEL

ROOF

- (25) ROOF OR CONVERTIBLE TOP
- (10) SUNVISOR, FITTING(S) &/OR TOP MOLDING
- (26) ROOF SIDE RAIL
- (24) COAT HOOK
- (18) DOME LIGHT
- (39) BACKLIGHT HEADER
- (68) ROOF MOUNTED CONTROLS/CONSOLE
- (69) ROLL BAR

EXTERIOR SURFACE OF CASE VEHICLE

- (37) OUTSIDE SURFACE OF CASE VEHICLE (*SPECIFIC AREA UNKNOWN*)
- (35) HOOD OF CASE VEHICLE
- (60) EXTERIOR OF CASE VEHICLE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (62) EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE
- (63) TRUNK LID OF CASE VEHICLE
- (64) TIRES OF CASE VEHICLE

BEYOND CASE VEHICLE BOUNDARY

- (36) AREA EXTERIOR TO CAR (*SPECIFIC AREA UNK.*)
- (70) HOOD OF OTHER VEHICLE
- (71) OTHER VEHICLE EXTERIOR HARDWARE (*E.G. OUTSIDE MIRRORS, ANTENNA, TRIM*)
- (73) EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE
- (74) HEADLIGHT OR FRONT GRILL OF OTHER VEH.
- (75) TRUNK OF OTHER VEHICLE
- (76) OUTSIDE SURFACE OF OTHER VEHICLE
- (77) TIRES OF OTHER VEHICLE
- (78) GROUND
- (79) WATER
- (80) EXTERIOR OBJECT (*NOT VEHICLE, GROUND, OR WATER. PLEASE DESCRIBE.*)


PENETRATING OBJECTS

- (61) OTHER VEHICLE
- (72) OBJECTS (*DESCRIBE*)

MISCELLANEOUS

- (00) NO CONTACT (*INVALID FIELD FORM CODE*)
- (38) OTHER (*E.G. FIRE. DESCRIBE*)
- (90) SPARE TIRE
- (96) INDUCED
- (97) EJECTED, UNKNOWN CONTACT
- (98) IMPACT FORCE, "WHIPLASH", HYPEREXTENSION/COMPRESSION
- (99) UNKNOWN AREA OF CONTACT

THE FIGURE BELOW
IS AN EXPLANATION OF THE BODY REGION CODES
LISTED ON PAGE IC - 4.

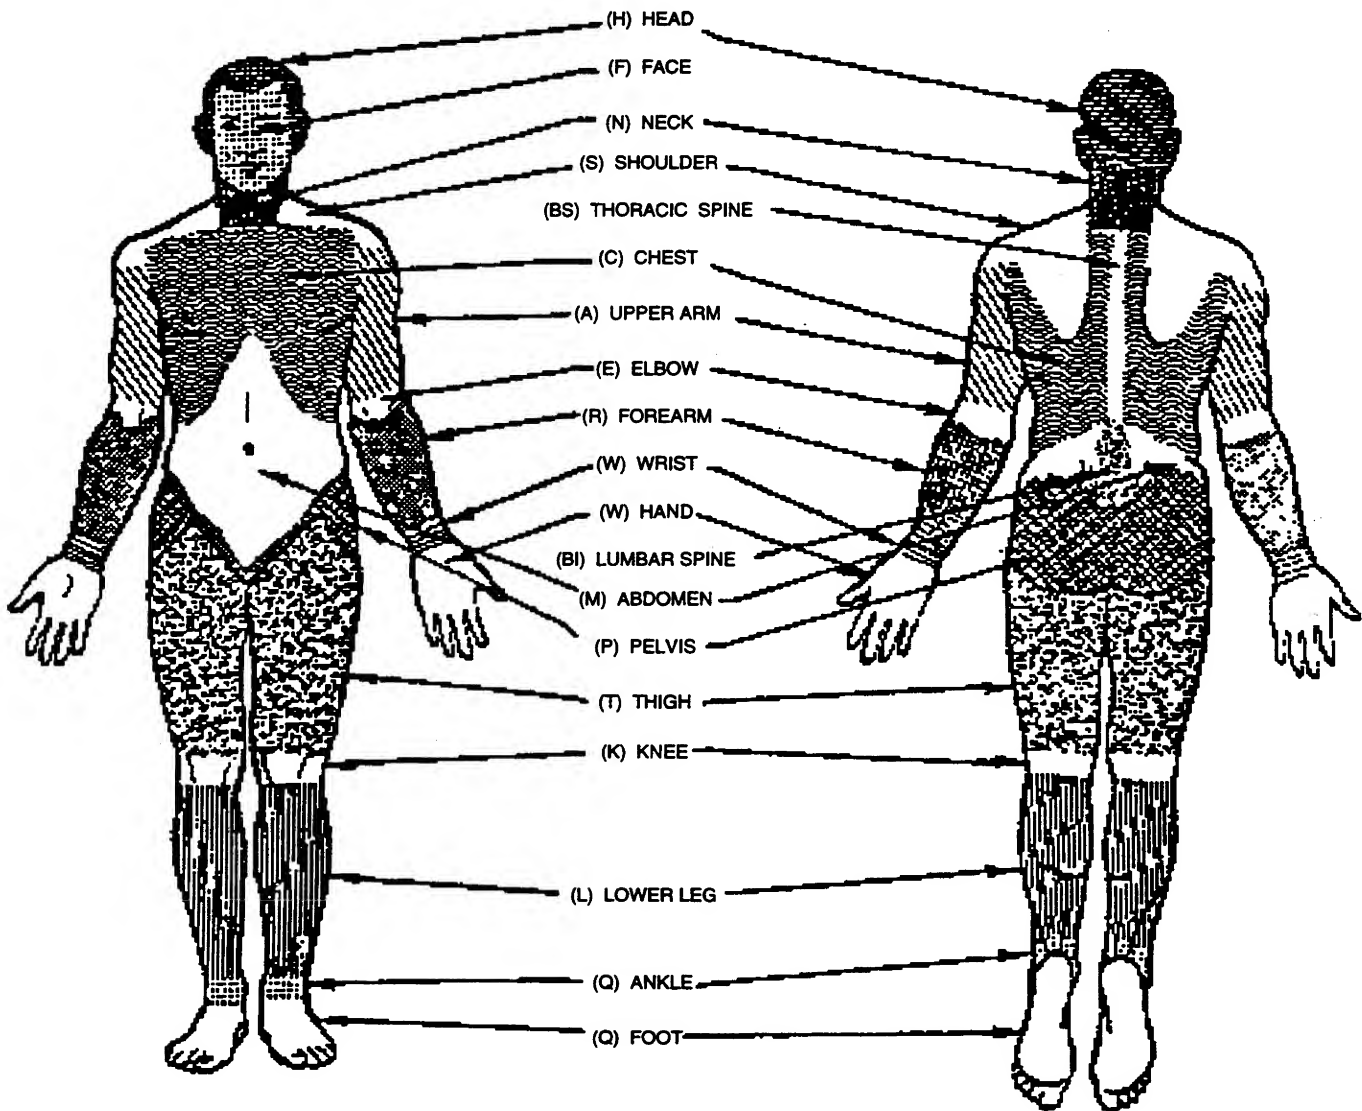

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

1 BODY REGION

(H) HEAD/SKULL
 (F) FACE
 (N) NECK
 (S) SHOULDER
 (X) UPPER EXTREMITIES
 (A) ARM (*UPPER*)
 (E) ELBOW
 (R) FOREARM
 (W) WRIST/HAND
 (C) CHEST
 (M) ABDOMEN
 (B) BACK
 (P) PELVIC/HIP
 (Y) LOWER EXTREMITIES
 (T) THIGH
 (K) KNEE
 (L) LEG (*LOWER*)
 (Q) ANKLE/FOOT
 (O) WHOLE BODY
 (U) UNKNOWN

3 LESION

(L) LACERATION
 (C) CONTUSION
 (A) ABRASION
 (F) FRACTURE
 (P) PERFORATION,
 PUNCTURE
 (K) CONCUSSION
 (V) AVULSION
 (R) RUPTURE
 (S) SPRAIN
 (D) DISLOCATION
 (N) CRUSH
 (M) AMPUTATION
 (B) BURN
 (G) DETACHMENT,
 SEPARATION
 (Z) FRACTURE AND
 DISLOCATION
 (T) STRAIN
 (E) TOTAL SEVERANCE,
 TRANSECTION
 (O) OTHER
 (U) UNKNOWN

4 SYSTEM/ORGAN

(S) SKELETAL
 (V) VERTEBRAE
 (J) JOINTS
 (D) DIGESTIVE
 (L) LIVER
 (N) NERVOUS SYSTEM
 (B) BRAIN
 (C) SPINAL CORD
 (E) EARS
 (O) EYES
 (A) ARTERIES
 (H) HEART
 (Q) SPLEEN
 (G) UROGENITAL
 (K) KIDNEYS
 (R) RESPIRATORY
 (P) PULMONARY/LUNGS
 (M) MUSCLES
 (T) THYROID, OTHER
 ENDOCRINE GLAND
 (I) INTEGUMENTARY (*SKIN*)
 (W) ALL SYSTEMS IN REGION
 (U) UNKNOWN

2 ASPECT

(R) RIGHT
 (L) LEFT
 (B) BILATERAL
 (C) CENTRAL
 (A) ANTERIOR/FRONT
 (P) POSTERIOR/BACK
 (S) SUPERIOR/UPPER
 (I) INFERIOR/LOWER
 (W) WHOLE REGION
 (U) UNKNOWN

BODY REGION	ASPECT	LESION	SYSTEM/ORGAN	SEVERITY
1	2	3	4	5

5 SEVERITY
(OR "AIS", ABBREVIATED INJURY SCALE)

(0) NONE
 (1) MINOR
 (2) MODERATE
 (3) SERIOUS
 (4) SEVERE
 (5) CRITICAL
 (6) MAXIMUM
 (9) UNKNOWN



PN 17700 #2



PN 17700 #3



PN 17700 #4




PN 17700#5



PN 17700 #8



PN 17700#7

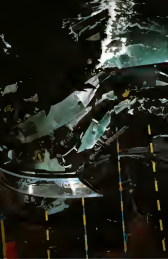

PN 17700 #B
Best Available



PN 17700 #9



PN 17700#10



PN 17700411



PN 17700 #12
Best Available



PN 17700 #13



PN 17700 #14



PN17700 #15



PN 17700 #16



PN 17700 #17



PN 17700 #18



PN 17700 #19



PN 17700 #20



PN 17700 #21



PN 17700 #22



PN 17700-#23



PN 17700 #24



PN 17700 #25




PN 17700#26



PN 17700 #27



PN 17700 #28

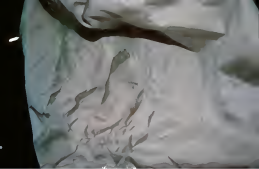

PN 17700 #29



PN 17700 #30



PN 17700 #31



PN 17700 #32



PN 17700 #33



PN 17700-#34



PN 17700 #35



PN 17700 #36



PN 17700 #37



PN 17700 #38



PN 17700 #39



PN 17700 #40



PN 17700 #41



PN 17700#42



PN 17700 #43



PN 17700 #44



PN 17700#45



PN 17700 #48



PN 17700#47



PN 17700 #48



PN 17700 #49



PN 17700 #50



PN 17700 #51



PN 17700 #52



PN 17700 #53



PN 17700 #54

